Service visit to FAR

10/12/13 14:38-14:45

Added a third stake to the soil mote 'mast'.

Removed serial FET plus power jumpers on serial ports for power monitor motes.

Removed down-facing pyrgeometer which was flat-lined for Rpile.

Opened the pyrgeometer in the lab and checked the thermopile voltage and continuity of the connectors. All looked okay.

17:18 After testing pyrgeometer at NEAR, reinstalled at FAR. Chances are we could have 'fixed' the pyrgeometer simply with by switching the power off and on