

# Site Visit Riverton7

13Jan11 15:15-17:00 local

conditions: overcast, very light winds

Reason: rlw.in down beginning at ~17z this morning

~21:55z back up

Desiccant shot on both rlw.in and rsw.in. renewed both.

rlw.in =0x65, sn2

Had to dissect sensor and test w/serial mote in vehicle. Probable cause may be the tiny 2pin, 1mm connectors inside the case, in particular the power one, had some corrosion from water vapor. After contact renew on i2c main connector and fiddling with those inside it resurrected. Could also be wire problem with those also. Keep an eye on this one.