

All Log Contents



[Flux tower anchor positions](#)

[Kurt Knudson](#) posted on Oct 30, 2017
tower base

39.100585N

105.105618W

S.W. anchors

39.100595N

105.105905W

39.100578N

105.105776W

S.E. anchors

39.100432N

105.105384W

39.100316N

105.105247W

N. anchors

39.100678N

105.105425W

39.100806N

105.105431W



[Photos of dinged tower](#)

[Gordon Maclean](#) posted on Aug 25, 2014

Found these photos of the damage to the tower. The tower was fixed on Nov 6, 2009, <https://wiki.ucar.edu/x/DhAFaw>

Photos of Tower damage



- [turbtower](#)



[Naked Tower](#)

[Chris Golubieski](#) posted on Aug 26, 2013
August 17, 2013

All remaining brackets, booms and deer stands have been removed from Turb Towers. What remains is a beacon, two levels of lightning protection.

- [turbtower](#)



[sonic tilts](#)

[Gordon Maclean](#) posted on Jun 29, 2013


The following plots were made with our Splus function, `plot.tilt`, that does a linear least squares fit to find the plane of mean flow, and plots the wind vector elevation angle vs azimuth. The planar fit becomes a sine curve on the tilt plot.



See [EOL sonic tilt documentation](#).

From a long term plot of the sonic "diag" value, I chose two periods where the the values were consistently very small. `plot.tilt` discards 5 minute wind averages when "diag" is above 0.01, or more than 1% of the data has a non-zero CSAT3 diagnostic value.

For the upper sonics at 16, 30 and 43 meters, the minimum wind speed used for the fit was 1.0 m/s. For the lower sonics at 2 and 7 meters, the minimum wind speed was set to 0.5 m/s. This didn't have much effect on the fit, however.

Feb 21 to April 4, 2011

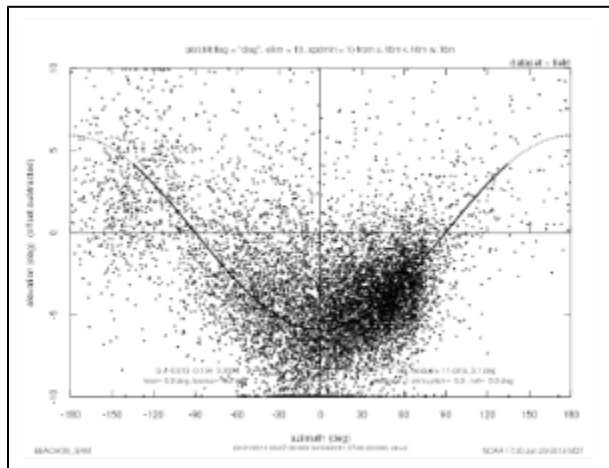[illegible][illegible]

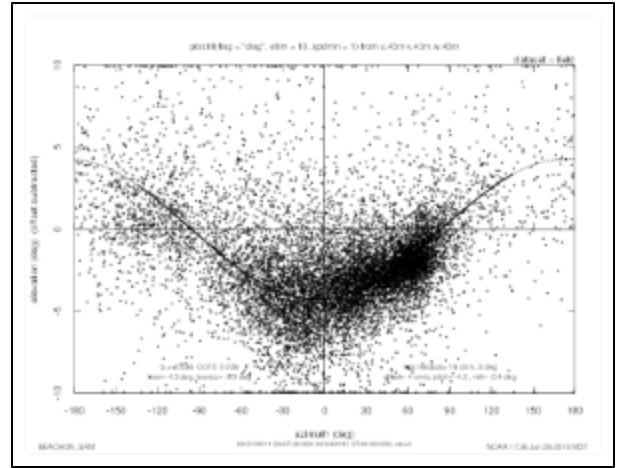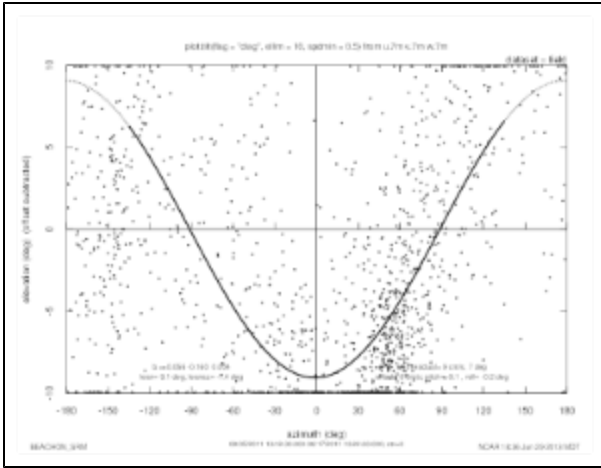

| date | height (m) | lean | leanaz (deg) | w offset (m/s) | elevation residual rms (deg) | offset residual rms (m/s) | notes |
|--------------|------------|------|--------------|----------------|------------------------------|---------------------------|---|
| Feb-Apr 2011 | 2 | 4.1 | -1.7 | 0.03 | 2.9 | 0.04 | |
| | 7 | 5.9 | 8.2 | 0.07 | 5.7 | 0.08 | |
| | 16 | 5.9 | -0.2 | -0.01 | 3.1 | 0.011 | |
| | 30 | 4.5 | -2.1 | 0.02 | 2.7 | 0.014 | |
| | 43 | 4.3 | -5.9 | 0.04 | 3 | 0.02 | |
| Aug 2011 | 2 | 5.6 | -6.3 | 0.04 | 2.6 | 0.03 | |
| | 7 | 9.1 | -1.4 | 0.06 | 7 | 0.09 | large tilt value, too much scatter for good fit |
| | 16 | 5.9 | 4.6 | -0.01 | 3.4 | 0.01 | |
| | 30 | 4.3 | -0.9 | 0.00 | 3.6 | 0.01 | |
| | 43 | 4.4 | -5.5 | 0.01 | 4.2 | 0.02 | |

Tom says that typical droop of sonic booms results in 1 to 2 degree tilts. The sonic booms point up-slope from the tower, so the approximate 5 degree tilts seen here are a combination of the boom "droop" and the slope of the terrain.

They generally agree on an approximate 5 degree tilt of the sonics relative to the mean flow, except the 9.9 degree tilt for the 7m sonic in Aug 2011.

There appears to be some local "disturbance in the force", causing a pinched effect at 2 meters, and to a lesser extent at 7 meters, so that winds straight into the sonic have an additional downward inclination.

There seems to be good agreement at 16 meters and above between the two fits. I suggest using the average of the two values for those levels. Perhaps we need to look at more data for 2 and 7 meters.

```
dpar(start="2011 2 21 00:25",end="2011 4 4 07:26",coords="instrument")
dpar(hts=2)
plot.tilt(flag="diag",ellim=10,spdmin=0.5)
```

- sonic



Testing Verizon Modem

Gordon Maclean posted on Mar 08, 2013

As a test of whether a 3G cellular modem could replace the WIFI network connection at Manitou Forest Observatory, I've setup a titan DSM in my office, with a Cradlepoint CTR350 router and a Verizon USB720 modem. The modem uses an external antenna (6" dipole) in the window of my office.

The modem's signal strength can be viewed from the **Modem->Info** page of the router's WWW interface. It is currently showing a 92% signal strength at -79 dBm:

| Name | Value |
|--------------------------|---|
| Manufacturer: | Novatel Wireless Inc. |
| Model Info: | MC760 VERIZON |
| Modem Firmware Version: | Q6085BDRAGONFLY_V139 [Jul 02 2009 18:00:00] |
| Carrier Status: | UP |
| ESN/IMEI: | 5B4F86F2 |
| Mobile Directory Number: | 7204707887 |
| Connection Type: | CDMA |
| PRL Version: | 53013 |
| Signal Strength (%): | 92 |
| Signal Strength (dBm): | -79 |
| PhysicalPort | USB1 |
| Connection Status: | Connected |

CTR350 serial number: MM090168701586

CTR350 MAC: 00 30 44 06 bc 0f

Crontab entries check the status of the ethernet and Verizon link, and can power cycle the router if necessary:

```
# Only run router_check.sh if net_check.sh succeeds to avoid power cycling modem if the problem is with the ethernet connection
1,31 * * * * net_check.sh eth0 192.168.0 192.168.0.1 && router_check.sh 8 www.eol.ucar.edu www.google.com
# Every 4 hours, run router_check.sh by itself, in case the router needs
# power cycling to get the ethernet working
10 */4 * * * router_check.sh 8 www.eol.ucar.edu www.google.com
```

Rsync transfers from the Titan to FLAB are running at about 61 KB/sec. This was a transfer with compression enabled, of binary files (shareable libraries):

```
sent 294 bytes received 5998216 bytes 61523.18 bytes/sec
total size is 16029060 speedup is 2.67
```

Transfers the other way are about 85 KB/sec:

```
sent 5998221 bytes received 214 bytes 85084.18 bytes/sec
total size is 16029060 speedup is 2.67
```

Remote Admin

Remote admin is enabled on port 30080 from all hosts with 128.117 IP addresses. However I have not been able to successfully get past the login screen. After entering the password, nothing more appears. Firefox status bar says "Transferring...". tcpdump shows packets arriving from port 80 of isfs4.dyndns.org, but nothing is rendered. Cradlepoint tech help says it is because the signal strength of -80 dBm is too low, that it needs to be up around -65 to -70. He says he did get past the login screen, but I have never been able to. I'm dubious. Maybe its a Firefox thing? Steve Oncley just tried Chrome and Safari. No luck.

With the system outside, the signal strength showed as 96%, -77 dBm, but still remote admin would not work.

Power Supply

The power supply consists of the following in a cooler box:

- Power-One HB12 supply, 12V, 1.7A
- Morningstar Sunguard charge controller
- Panasonic lead-acid, 12V, 7.2 Ah battery

On Mar 12, started testing the whole system, modem, router, DSM and power supply in the back lot of FL1 near the yard maintenance shed. Will watch the voltages to see that the HP12, controller and battery can keep up.

Kurt felt the values on 3/13 were too low to maintain a healthy battery, so he turned a pot on the charger to increase the voltage. The values for 3/14 are much better.

| Date | HB12 Output | Battery |
|------|-------------|---------|
| 3/13 | 12.1 V | 12.08 V |
| 3/14 | 14.2 V | 13.7 V |

Installed

On March 21, at 11:55 MDT, John Ortega installed the system at Manitou. It came up and is online, and has registered with DynDNS as mfogw.dyndns.org. It is mounted on the scaffolding tower, next to the Skybeam WIFI. A little 6" dipole antenna is connected to the Verizon modem. He attached a grounding strap from the gray DSM box to the tower. There is an ethernet surge protector inside the box to provide protection on the ethernet cable coming up the tower, once it is connected. A GPS is on port 3 and NTP looks good.

Here is the current network configuration. Note that it is not connected to the rest of the MFO network at this time.

| host | address |
|--------------------|--------------|
| Cradlepoint router | 192.168.0.1 |
| RAL server | 192.168.0.5 |
| DSM | 192.168.0.10 |

The RAL server at 192.168.0.5 is configured as the DMZ host - the Cradlepoint should pass all traffic, except those ports otherwise forwarded, to the RAL server.



[Turb Tower Vist 9282012](#)

[Chris Golubieski](#) posted on Oct 03, 2012
September 28, 2012

Chris and Lisa

All equipment has been removed from the Turbulence Tower. Three sonics, two Licors, five TRHs, barometer, 4-comp, dsm, ALL cables (except eth), batteries, charger.

Things that we kept there were all TRH booms, barometer boom, three sonics booms, CSAT electronic plates (3), 4-comp boom WITH mounting plate and deer stand.

Gear that is in EOL: Five TRHs, two sonic booms, three CSAT electronic plates, 4-comp, barometer, three batteries, power cable and splitters.

Most gear was sent to SCP due to lightening strike on September 27th. At this point I will go through cables and repair as much as I can with what supplies we have in the lab. Most cables need repair.

- [turbtower](#)
- [sonics](#)
- [trh](#)
- [pressure](#)
- [dsm](#)
- [licor](#)



[Turb Tower Site Visit 9252012](#)

[Chris Golubieski](#) posted on Sep 26, 2012
September 25, 2012

Afternoon

Chris and Lisa

Replaced barometer with another barometer. Do not know serial number on new unit. It is coming in but not parsed the same.

Removed sonic at 8m and 30m.

- [pressure](#)
- [sonic](#)

- turbtower



Summary of Licor deployments and failures

Gordon Maclean posted on Sep 04, 2012

From my reading of the logbook, the licors were at these heights, starting at the given dates:

| level | Nov 18, 2009 | Dec 2, 2009 | Feb 2, 2010 | Mar 29, 2011 | Apr 12, 2011 | Oct 14, 2011 | Dec 15, 2011 | Jun 26, 2012 | Aug 15, 2012 |
|-------|--------------|-------------|-------------|--------------------------|-------------------------|-------------------------|--------------|--------------------------|--------------------------|
| 2 | 0813 | | 1163 | removed all, calibration | 1166 | 1166 | 1166 | removed all, fire danger | 0813 |
| 7 | 1166 | 1166 | 1166 | | | 0813 | | | |
| 16 | 1167 | 1167 | 1167 | | 1163 failed Oct 2, 2011 | 1167 failed Nov 6, 2011 | 0813 | | 1164 failed Aug 23, 2012 |
| 30 | 1163 | 1163 | | | | | | | |
| 43 | 1164 | 1164 | 1164 | | 1164 | 1164 | 1164 | | 1166 |

Failures:

Summer 2009: SN 0813, 1166 fixed at Licor after lightning damage prior to being deployed at Manitou.

Oct 2, 2011: 16m, SN1163, <https://wiki.ucar.edu/x/cKmrB>

Nov 6, 2011: 16m, SN1167, <https://wiki.ucar.edu/x/jofpB>

Aug 23, 2012: 16m, SN1164, <https://wiki.ucar.edu/x/boHCBg>

- turbtower
- licor



16m Licor out since Aug 23

Gordon Maclean posted on Sep 04, 2012

According to <https://wiki.ucar.edu/x/HwCIBg>, the 16m licor is SN1164.

http://www.eol.ucar.edu/isf/projects/BEACHON_SRM/isfs/qcdata/plots/2012/08/23/licor_20120823.png

On Aug 23 18:48:30, the diag initially dropped from a good value of 249 to 118-121.

```
2012 08 23 18:48:30.5894 0.1001 49 249\t0.07072\t12.6021\t0.05373\t415.742\t19.45\t76.2\t\n
2012 08 23 18:48:30.6894 0.1 49 249\t0.07068\t12.6090\t0.05378\t416.812\t19.45\t76.2\t\n
2012 08 23 18:48:30.7894 0.1 49 121\t0.07176\t12.6058\t0.00112\t418.920\t19.45\t76.2\t\n
2012 08 23 18:48:30.8893 0.09994 49 119\t0.06758\t12.5810\t0.00463\t435.376\t19.45\t76.2\t\n
2012 08 23 18:48:30.9893 0.09998 48 118\t0.06661\t12.4256\t0.01945\t-6.373\t19.43\t76.2\t\n
2012 08 23 18:48:31.0896 0.1003 48 118\t0.06405\t11.7233\t0.03659\t56.809\t19.45\t76.2\t\n
2012 08 23 18:48:31.1894 0.09977 49 118\t0.06470\t11.6094\t0.04970\t170.629\t19.45\t76.2\t\n
2012 08 23 18:48:31.2893 0.09994 49 118\t0.06822\t11.0511\t0.06201\t287.164\t19.43\t76.2\t\n
```

After the number of bytes (49 or 48) is the licor data record. The data fields (diag,co2raw,co2,h2oraw,h2o,Tcell,Pcell) are separated by tabs (\t)

A diag of decimal 118 is binary 01110110, where bits 0,3 and 7 are 0.

bits 0-3 are the AGC, automatic gain control. The critical diag bits are 4-7.

See: ftp://ftp.licor.com/perm/env/LI-7500/Manual/LI-7500Manual_V4.pdf, page 3-36.

Bit 4 is Sync:

Sync Flag - If not OK, indicates that the LI-7500 embedded software and the digital signal processor (DSP) receiving the signal from the chopper motor in the sensor head are out of sync. Check cabling.

Bit 5 is the PLL:

PLL - Phase Lock Loop offset, indicates the status of the chopper motor. If not OK, there may be a problem with the chopper motor in the sensor head.

Bit 6 is the detector:

Detector - If not OK, indicates the detector cooler is not maintaining the proper temperature: this will happen at temperatures above 50 °C. Note that this does not always indicate a serious problem; the cooler may simply have not yet reached the target temperature during instrument startup, or it may be out of range due to external environmental conditions. Readings may still be OK. Check cables and wiring.

Bit 7 is the chopper:

Chopper - If not OK, indicates the chopper temperature controller is out of range, hot or cold. As with the Detector indicator above, this may or may not indicate a serious problem. The chopper should be able to temperature control when ambient is between +50 and -25 °C.

Since Aug 23, the diagnostic value has been all over the map, with bits 5,6,7 changing over the day. Here's a snippet of data from Aug 30. Diag=159, binary 10011111, bits 5 and 6 are 0 (not OK), bits 4 and 7 are OK.

```
159\t0.84090\tOverflow\t0.85015\tOverflow\t30.04\t76.3\t\n159\t0.14794\tOverflow\t-0.15488\tOverflow\t30.04\t76.3\t\n159\t0.74279\t1034826496\t0.88954\tOverflow\t30.06\t76.3\t\n
```

I think Tcell and Pcell have always looked OK.

- [licor](#)
- [turbtower](#)



[Site Visit to Turb Tower 08172012](#)

[Chris Golubieski](#) posted on Aug 30, 2012
August 17, 2012

10:00am - 1:30pm MDT

Three batteries installed at Turbulence Tower. Four component was installed and working. New TRH 2m top plate. New 2m sonic (CSAT0536) was installed to replace odd sonic.

- [radiation](#)
- [sonic](#)
- [turbtower](#)



[Site Visit 08152012](#)

[Chris Golubieski](#) posted on Aug 30, 2012
August 15, 2012

10:30am - 3:00pm

Putting freshly calibrated sonics (CSATs) on turbulence tower with Licors, TRHs and barometer. The four-component radiation did not get mounted due to a mount missing. System was check with just a charger powering instruments but then shut off due to missing batteries. Everything looks good but the 2m sonic.

Guy tensions were checked.

Remember: Batteries, radiation mounting plate, radiation instrument, boom and electronics box.

45m: CSAT0537, Licor 1166

30m: CSAT0853

15m: CSAT0539, Licor 1164

7m: CSAT0800

2m: CSAT0855, Licor 0813

- [turbtower](#)



[Updated kernel with small interrupt mod](#)

[Gordon Maclean](#) posted on Aug 23, 2012
Aug 23, 11:30 am

Installed a new kernel with one small difference in the PC104 interrupt handling. If the PC104 interrupt handler is called, and it sees no bits set in the pending value, then it goes ahead and call handlers for all unmasked PC104 interrupts (which in manitou's case is just one, IRQ 3).

This logic was also in the patched 2.6.16 kernel. It counted these "spurious" interrupts and from time to time, complained about them. The new code doesn't log any complaints. The intcount script could be used to see if it is happening frequently.

Since re-installing the data system last week, with the new kernel, I've seen a few timeouts where all data from the emerald cards cease. This patch may help that.

- [data-system](#)

- [turbtower](#)



[Upgraded data system software, reduced licor interrupts](#)

[Gordon Maclean](#) posted on Aug 20, 2012

The data system was re-installed on Aug 15. It is the same hardware (CPU, serial cards, usb disk, enclosure and interface panels) as before.

The Linux kernel has been upgraded, from 2.6.16 to 2.6.35. This kernel has PPS support, so an extra patch was not needed to get the PPS from the GPS. It also does not have the bug where executables could not be run from compact flash. Therefore they are not copied to ram disk at bootup.

This kernel also sets the PC104 CPLD to do the default linux-style interrupt handling, where AUTO_CLR and RETRIG are not enabled as before. The GPIO interrupt that serves the PC104 is now an edge detect interrupt. It has a patched handler for the edge detected interrupts.

The Licors are also modified with a fix that was found when testing at FLAB. Because the CTS line into the DSM was allowed to float, then it generated interrupts over a long cable. They occur when the TX line from the Licor is active, so it must be some sort of cross talk. It is not simple to disable CTS interrupts in the kernel. Instead, the CTS to the DSM was looped back to RTS from the DSM in the Licor box and not allowed to float. The Licor CTS was already looped back to its RTS in the box, so this is a symmetrical loopback.

We shouldn't see any of the "spurious interrupt" messages, primarily because the kernel now doesn't complain about them, but also since we are not getting the storm of CTS interrupts, then things should be much more predictable.

- [data-system](#)
- [li7500](#)
- [turbtower](#)



[Interesting event](#)

[Steve Oncley](#) posted on Jul 06, 2012

Just flipping through the data, have noticed what appears to be a nice sweep event (upper air intrusion into the canopy) at about 2011 Oct 5 23:30*.*

- [science](#)



[Tower Equipment Stripped](#)

[Chris Golubieski](#) posted on Jun 28, 2012

June 26, 2012

11:00am - 2:05pm MDT

Removal of all sensors on the Turbulence Tower today. Sonics, Licors, TRHs, pressure, four-component, batteries and dsm. Cables have remained on tower. Kept beacon on also.

Since we left cables on tower we had to mark cables on the dsm side so we know what instrument it was and which port. This was our organization codes using colored paper clips, zip ties and electrical tape. All levels have a sonic, TRH and Licor which are bundled together. This is the code for the bundle.

CSAT marked with zip tie

TRH marked with tape

Licor marked with nothing.

Heights are marked with paper clip colors.

45m - Green

30m - Pink

15m - Blue

8m - Yellow

2m - White

Additional random cables.

Ethernet - 1 SMALL zip tie, no clip

Rad22m - 2 SMALL zip ties, no clip

Pressure - 3 SMALL zip ties, no clip

dsm was taken down at 11:35am.

WE NEED PRESSURE TUBING!

- [turbtower](#)
- [trh](#)
- [sonic](#)
- [pressure](#)
- [licor](#)



[Lab testing of sensors and data system](#)

[Gordon Maclean](#) posted on Jun 28, 2012

We have all the sensors and the data system running in the staging area. We've added one Licor 7500 to what was last on the tower, for a total of 4 Licors. The data cables, and Licor power cables are different however, since the originals were left on the tower.

After setting it up, I increased the 4 Licor 7500s from 10 samples/sec at 9600 baud to 20 samples/sec at 19200 baud.

The spurious interrupts are happening, sometimes spiking to above 100:

```
Jun 28 21:27:02 manitou kernel: viper_irq_handler: irq=2 spurious= 326001, #/sec=102
Jun 28 21:27:21 manitou kernel: viper_irq_handler: irq=2 spurious= 328001, #/sec=109
Jun 28 21:29:06 manitou kernel: viper_irq_handler: irq=2 spurious= 338001, #/sec=102
Jun 28 21:29:46 manitou kernel: viper_irq_handler: irq=2 spurious= 342001, #/sec=106
Jun 28 21:29:56 manitou kernel: viper_irq_handler: irq=2 spurious= 343001, #/sec=102
Jun 28 21:30:38 manitou kernel: viper_irq_handler: irq=2 spurious= 347001, #/sec=103
Jun 28 21:30:48 manitou kernel: viper_irq_handler: irq=2 spurious= 348001, #
/sec=101
Jun 28 21:31:28 manitou kernel: viper_irq_handler: irq=2 spurious= 352001, #/sec=111
Jun 28 21:31:58 manitou kernel: viper_irq_handler: irq=2 spurious= 355001, #/sec=104

root@manitou root# uptime
 21:44:36 up  1:43,  1 user,  load average: 0.16, 0.11, 0.09
```

The kernel issues a "spurious" message when they occur more often than 100/sec. The system came up at 21:44 - 1:43 = 20:01. At the time of the last message above, the system had been up for 1 hour 31 minutes. 355001 interrupts in 1 hour 31 minutes averages to 65/sec.

The above test is with the same kernel (2.6.16.28-arcom1-2-viper #1 PREEMPT Wed Sep 16 17:04:19 MDT 2009) and CPU (viper 4) as was deployed on the tower.

| | | | | | | |
|--|---|-----|-----------------------------|--------------------|-------|-------|
| manitou:/dev/ttyS9 1.043 19 19 | 1 | 20 | 14 2012 06 28 23:13:12.975 | 06 28 23:13:26.005 | 1.00 | 0.938 |
| manitou:/var/tmp/gps_pty0 0.882 72 73 | 1 | 30 | 29 2012 06 28 23:13:12.574 | 06 28 23:13:26.574 | 2.00 | 0.154 |
| manitou:/dev/ttyS1 0.054 12 12 | 1 | 100 | 285 2012 06 28 23:13:12.624 | 06 28 23:13:26.820 | 20.01 | 0.046 |
| manitou:/dev/ttyS5 0.979 30 30 | 1 | 120 | 15 2012 06 28 23:13:12.893 | 06 28 23:13:26.489 | 1.03 | 0.965 |
| manitou:/dev/ttyS6 0.058 12 12 | 1 | 200 | 285 2012 06 28 23:13:12.654 | 06 28 23:13:26.852 | 20.00 | 0.044 |
| manitou:/dev/ttyS7 0.059 56 56 | 1 | 210 | 285 2012 06 28 23:13:12.619 | 06 28 23:13:26.814 | 20.01 | 0.042 |
| manitou:/dev/ttyS8 0.986 29 29 | 1 | 220 | 14 2012 06 28 23:13:13.516 | 06 28 23:13:26.256 | 1.02 | 0.974 |
| manitou:/dev/ttyS10 0.061 12 12 | 1 | 300 | 285 2012 06 28 23:13:12.652 | 06 28 23:13:26.854 | 20.00 | 0.041 |
| manitou:/dev/ttyS11 0.056 49 49 | 1 | 310 | 285 2012 06 28 23:13:12.621 | 06 28 23:13:26.825 | 19.99 | 0.045 |
| manitou:/dev/ttyS12 0.986 29 29 | 1 | 320 | 15 2012 06 28 23:13:13.098 | 06 28 23:13:26.775 | 1.02 | 0.971 |
| manitou:/dev/ttyS19 5.002 56 56 | 1 | 330 | 3 2012 06 28 23:13:10.785 | 06 28 23:13:20.787 | 0.20 | 5.000 |
| manitou:/dev/ttyS13 0.054 12 12 | 1 | 400 | 285 2012 06 28 23:13:12.658 | 06 28 23:13:26.858 | 20.00 | 0.046 |
| manitou:/dev/ttyS14 0.052 49 49 | 1 | 410 | 286 2012 06 28 23:13:12.593 | 06 28 23:13:26.845 | 20.00 | 0.047 |
| manitou:/dev/ttyS15 0.980 30 30 | 1 | 420 | 14 2012 06 28 23:13:13.374 | 06 28 23:13:26.024 | 1.03 | 0.969 |
| manitou:/dev/ttyS20 0.053 12 12 | 1 | 500 | 286 2012 06 28 23:13:12.622 | 06 28 23:13:26.869 | 20.00 | 0.047 |
| manitou:/dev/ttyS17 0.058 49 49 | 1 | 510 | 285 2012 06 28 23:13:12.619 | 06 28 23:13:26.824 | 19.99 | 0.042 |
| manitou:/dev/ttyS18 0.984 30 30 | 1 | 520 | 14 2012 06 28 23:13:13.284 | 06 28 23:13:25.990 | 1.02 | 0.970 |

- [data-system](#)



[TRH 012 \(30m\) fan out](#)

[Gordon Maclean](#) posted on Jun 27, 2012

Gordon Jun 27, 2012

After removing the sensors and data system, we're testing the set up back in Boulder, to see if we can duplicate the problem of not being able to sample 5 licors.

In setting up the test, noticed that the fan on TRH012 does not run, but the TRH does output data. Checking the data archive, that unit is data id 1,420, which was the 30 meter TRH. Will check with Chris in case he noticed whether the fan was running when he removed the sensor.

If the fan was out while the unit was on the tower, then T,RH at 30m data should be treated with suspicion. By looking at the profiles, one might be able to determine when the fan went out.

According to Ned, it is very likely that the fan connection was damaged when the unit was removed from the tower.

- [turbtower](#)
- [trh](#)



[Sensors and DSM removed from tower](#)

[Gordon Maclean](#) posted on Jun 27, 2012

Jun 26, 2012

- [turbtower](#)
- [data-system](#)



[Turbulence tower outage](#)

Edward (Ned) Patton posted on Jun 08, 2012

The entire turbulence tower was down from May 31 until June 8. During this time, we were able to ping the datalogger but unable to log in. Richard Oakes from the USFS cycled the power on the datalogger at about 2pm on June 8, which restored access to the system.

All sensors came happily back to life, with the exception of the 2m LiCor that Gordon was able to resuscitate via sending ASCII commands to the sensor.

Comments added by Gordon:

From a phone conversation with Richard Oakes: He recalled a hail and lightning storm in the vicinity of the MFO during the afternoon and early evening of May 31, and that his wife noticed a lightning strike that she thought was in the vicinity of the turbulence tower that afternoon. His record indicates just 0.01 inch of precip on May 31.

To bring back the 2m licor, I used the commands shown in <https://wiki.ucar.edu/x/CAK9B>:

```

adn
minicom ttyS2
ctrl-a w  (enable line wrap)
ctrl-a e  (enable local echo)
ctrl-a f  (send BREAK)
(Outputs (BW 10) (Delay 0) (RS232 (Freq 10.0)))
ctrl-a q
aup

```

- [turbtower](#)
- [sonic](#)
- [communication](#)
- [co2](#)



[Network Switch](#)

Edward (Ned) Patton posted on Apr 01, 2012

The turbulence tower data had not been updating since March 17. A site visit by Ned found that the network issue preventing communication was associated with the 5-port Linksys/Cisco switch located in the waterproof power enclosure at the tower. Cycling the power on the switch brought back the network.

- [turbtower](#)
- [communication](#)



[Site Visit 12-15-2011](#)

Chris Golubieski posted on Dec 21, 2011

Who: Ned, Christopher

When: December 15, 2011. Arrived 9:51am, Departed 12:00pm

Removed Licor (sn 1176) from 15m.

Note, by Gordon, Jul 13, 2012: There is no sn1176. I think this must have been unit sn1167, which according to the log entry of 4/12/2011, was installed at 15m.

When removing this sensor due to bad chopper motor, it was not running. Rebooted sensor and heard the chopper motor in the head and it sounded bad. Removed the 7m Licor (sn0813) and taped up connections and moved this Licor to the 15m height. Plugged in all connections as normal (signal green cable and power through BNC). All looked (and sounded) great. Replaced the TRH fans at heights 7m and 15m. Both fans sounded REALLY bad. The 2m TRH fan did not sound very good either. Guessing we will be replacing that fan soon.

*Did notice that when the Licor 1176 was at 15m and before removal I checked power at the inside green connector. Voltage was going from 12.9V to 11.4 V every six seconds. Odd cycle, but this also seemed odd in general. Checked the power at the 7m height when removing that Licor and it had the same cycle but not as drastic. Took a voltage reading at dsm, voltage was cycling. Took reading at battery bank and did see the cycle but not as drastic. Noticed the battery charger was pulsing to charge the battery bank. It was on the 'deep cycle'. We switched charger to 'conventional cycle' and it all stopped. No more voltage swings. We also wanted to know why the batteries were not taking out that pulsing to the tower. One of the batteries must be bad or wrong charger for batteries. We unplugged the charger to see what the load did on the batteries, checking for bad battery. In 15minutes we dropped from 13.10V to 12.47V. Not much of a drop. Leaning to more of the wrong charger cycle and will monitor the battery bank on this current setting.

- [turbtower](#)
- [licor](#)
- [trh](#)



[15 m Li-COR out of service from November 6, 2011 to December 15, 2011](#)

Edward (Ned) Patton posted on Dec 15, 2011

15 m Li-COR (sn1176) dropped out of service on November 6, 2011.

Note, by Gordon, Jul 13, 2012: There is no sn1176. I think this must have been unit sn1167, which according to the log entry of 4/12/2011, was installed at 15m.

The diagnostic value dropped to 215 indicating that Bit 5 signaled that the instrument's chopper motor failed. There was an indication a number of hours earlier that the chopper motor was beginning to fail, see:

http://www.eol.ucar.edu/isf/projects/BEACHON_SRM/isfs/qcdata/plots/2011/11/06/licor_20111106.png

Chris and I made a trip to MFO to move the 7m Li-COR (sn 0813) up to 15m and to remove the dead instrument from 15m. The tower is therefore operating again with three levels of water vapor and CO2 fluxes (2m, 16m, 43m). See [Chris' entry](#) for details of this instrument swap and timing.

- [turbtower](#)
- [licor](#)
- [li7500](#)



[Fix bug in tee_tty of GPS data, new NIDAS code](#)

Gordon Maclean posted on Dec 09, 2011

Gordon, Dec 9 3:15 pm

Since Dec 1 22:50 UTC the DSM log file (/var/log/isfs/adam.log) has error messages that the GPS pseudo-terminal device, /var/tmp/gps_pty0, does not exist. Apparently the tee_tty process died at that time.

tee_tty reads the GPS ASCII messages on /dev/ttyS3, and writes them to two pseudo-terminals /dev/gps0 (read by NTP) and /var/tmp/gps_pty0 (read by dsm).

I'm not sure why tee_tty died, but decided that this was an opportunity to upgrade the NIDAS software on this system. The existing version was 5810M, current as of Nov 9, 2010.

Installed the latest and greatest, version 6364.

During this time I noticed that characters were being lost in the ssh session, such that I had to enter characters twice for them to get to the shell if the dsm process was running. I have a faint memory of this happening before. Determined that this is due to tee_tty exiting, leaving the symbolic links to the pseudo-terminals around. The dsm process re-opens the /var/tmp/gps_pty0 every 10 seconds after an error, and so if sshd creates a pseudo-terminal and /var/tmp/gps_pty0 points to it, then the dsm process will be stealing characters from the ssh session. Did a dump of the GPS data and saw my shell commands! Hacked myself 😊

Installed a new version of tee_tty, which will catch the HUP, INT and TERM signals, and clean up the symbolic links on exit. Tested it and things look good.

- [turbtower](#)
- [data-system](#)



[Disabled kernel warning messages on the console](#)

Gordon Maclean posted on Oct 24, 2011

The "spurious" IRQ messages are annoying when one is logged onto the system console at the tower. They are logged at a priority of "warning". They should have a lower priority, like debug, or info, unless the number/sec is above some threshold. Until that change is made, I'll disable them on the console, by setting the "-c 4" option in klogd, which then suppresses messages of warning and lower, which are numeric values 4-8. 3-0 are priorities from error to emerg.

That change was made to /etc/init.d/klogd on Oct 24, 16:45 UTC, and klogd restarted.

To see the spurious messages, do either of the following:

```
cat /proc/kmsg
dmesg
```

cat /proc/kmsg removes the messages from the kernel message ring buffer as they are read.

- [turbtower](#)
- [data-system](#)



Site visit - Licor 7500s - batteries

Gordon Maclean posted on Oct 14, 2011
Oct 14, 2011

Arrived: 9am MDT

Departed: 11am MDT

ChrisG and SteveS are on site to diagnose the sick licor 7500 at 16m and add the two licors that were at the CWEX11 project.

Chris could not hear the motor spinning on the 16m Licor 7500. A power cycle did not bring it back. While removing it, when the unit bumped against something, the motor started up, but was much more noisy than usual. It will be brought back for repair.

Installed SN 1167 at 16 meters, and 0813 at 7 meters. 30 meters still has no Licor.

From Boulder I (Gordon) set the sampling rate to 10 Hz and the baud rate to 9600. The Licors had been configured for 20 Hz, 19200 baud. From minicom, after adn:

```
adn
minicom ttyS7 (or ttyS11)
ctrl-a w (enable line wrap)
ctrl-a e (enable local echo)
ctrl-a f (send BREAK)
(Outputs (BW 10) (Delay 0) (RS232 (Freq 10.0) (Baud 9600)))
ctrl-a q
aup
```

They also swapped out the three main batteries.

Also checked tensions.

- [turbtower](#)
- [licor7500](#)



16m Licor sick, 2m soaked

Gordon Maclean posted on Oct 08, 2011

The data from the Licor at 16 meters went bad on Oct 2, while our system was not reachable over the network.

http://www.eol.ucar.edu/isf/projects/BEACHON_SRM/isfs/qcdata/plots/2011/10/02/co2_20111002.png

The ldiag averages went from the typical 248-255 range to around 216.

http://www.eol.ucar.edu/isf/projects/BEACHON_SRM/isfs/qcdata/plots/2011/10/02/licor_20111002.png

This CWEX11 logbook entry has some information about the licor diagnostic value:

<https://wiki.ucar.edu/x/nougB>

This morning at around 10:40 MDT, I logged in and looked at the high rate data with rserial. (The 16 meter licor is serial port 11) The diagnostic value is 215 = 11010111 binary. Bit 5 is 0 indicating the PLL is not OK.

According to the manual:

PLL - Phase Lock Loop offset, indicates the status of the chopper motor. If not OK, there may be a problem with the chopper motor in the sensor head.

Also just noticed there is not data on the plots from the 2 meter licor since 04:00 MDT this morning. That appears to be a moisture issue. I just logged in and did rserial (serial port 2):

```
rs 2
255\t0.11124\tOverflow\t0.11690\tOverflow\t2.77\t76.0\t\n
255\t-45877.11718\tOverflow\t-37005.95312^D\tOverflow\t2.78\t76.0\t\n
255\t-59961.00781\tOverflow\t-110557.73437\tOverflow\t2.77\t76.0\t\n
255\t0.86791\tOverflow\t0.94173\tOverflow\t2.79\t76.0\t\n
```

The \t are tabs between the values. 255 is the ldiag value, indicating a high AGC value, but all other diagnostic bits are OK. The second and fourth values in a message are the raw values for co2 and h2o, which look crazy, and the calibrated values are "Overflow". This will probably clear up when things dry out.

- [turbtower](#)
- [licor](#)



[Network down, back up](#)

[Gordon Maclean](#) posted on Oct 06, 2011

We have not been able to reach the turbulence tower data system since Sep 29.

We could ping the RAL server in the seatainer from Boulder. Andy Gaydos logged into the server and could not ping the data system: 192.168.100.202. So either the data system or the network between the seatainer and the tower was down.

On Oct 6 I was able to ssh to the DSM. So somebody fixed the problem, or perhaps a fiber<->copper transceiver reset itself.

I did not see anything in /var/log/ifs/messages about eth0 going down/up.

The DSM did not go down, so it wasn't a DSM power problem:

```
root@manitou root# date
Thu Oct  6 22:44:24 GMT 2011
root@manitou root# uptime
 22:45:18 up 464 days,  3:22,  2 users,  load average: 0.02, 0.05, 0.00
```

- [turbtower](#)
- [data-system](#)
- [network](#)



[Summary of Data System Timekeeping](#)

[Gordon Maclean](#) posted on Sep 06, 2011

Monitoring the accuracy of the system clock on a real-time data acquisition system provides useful information about the performance of the system. Hence this long discussion.

Data System Clock, NTP and GPS

The data system at the Manitou Forest Observatory (aka, the DSM) uses a GPS receiver and the NTP (Network Time Protocol) software to set the system clock, which, in addition to the normal uses of a system clock, is used to time-tag the data samples.

The serial messages from the GPS are received on serial port 3, /dev/ttyS3. The pulse-per-second square-wave signal (PPS) from the GPS is also connected to the DCD line of that serial port. A patch has been added to the Linux kernel on the data system so that an interrupt function can be registered to run in response to the DCD interrupts. This interrupt function will be called immediately after the rising edge of the PPS signal has been detected by the serial port hardware.

The NTP software on the DSM runs a reference clock driver for a Generic NMEA GPS Receiver, with PPS. This driver reads the 1 second GPS RMC records from the serial port, and registers a function to be run on receipt of the PPS interrupt. NTP then uses these two sets of information to create a GPS reference clock. NTP then monitors the state of the GPS reference clock and the system clock, and makes gradual adjustments to the system clock to bring it to close agreement with the GPS clock.

The RMC records contain the current date and time, in addition to latitude, longitude, and other quantities. The transmission time of the RMC message is not tightly controlled within the GPS and appears to be primarily effected by lags associated with internal GPS processing, and is also likely effected by what other NMEA messages are enabled for output on the GPS. The exact receipt time of the RMC message is **not** used for clock adjustments. NTP simply uses the time fields within the RMC message as an absolute time label for the previous PPS, whose timing is very precise.

Clock Variables

We monitor the following variables to keep track of the DSM timekeeping, and plot them on the daily web plots:

- GPSdiff: The time difference, in seconds, between the time-tag that was assigned to a RMC message and the date and time that is contained within the message. The time-tag assigned to a message sample is the value of the system clock at the moment the first byte of the message was received. For example, a value of 0.6 sec means that the data system assigned a time-tag to the RMC message that was 0.6 seconds later than the time value contained within the message. As discussed above, GPSdiff is not a precise measurement of clock differences and is not used to adjust the system clock. It gives a crude value of the agreement of the clocks and possible effects of I/O latency and buffering in the data system. When 5 minute statistics are computed, the maximum and minimum values of GPSdiff for each 5 minute period are written to the output NetCDF files as GPSdiff_max and GPSdiff_min.
- GPSnsat: number of satellites being tracked by the receiver, that is, the number of satellites whose signals are used in its time and location solution. GPSnsat in the NetCDF files and plots is a 5 minute mean.

NTP on the DSM is configured to log its status in a "loopstats" file. See <http://www.eecis.udel.edu/~mills/ntp/html/monopt.html> for information on the NTP monitoring options. The loopstats file includes these variables, which have been merged into the Manitou data archive:

- NTPClockOffset: the estimated offset of the GPS time from the data system time. A positive value indicates that NTP has determined that the GPS clock is ahead of the system clock, i.e. the GPS is showing a later time than the system clock. The maximum, minimum and mean values of NTPClockOffset in each 5 minute period are computed and written to the NetCDF files and plotted as NTPClockOffset_max, NTPClockOffset_min and NTPClockOffset.
- NTPFreqOffset: the correction applied to the system clock frequency in parts-per-million. A positive value indicates that NTP has determined that the system clock oscillator is slow and the NTPFreqOffset PPM values are being added periodically to the system clock counter. The NetCDF files and plots contain 5 minute means of NTPFreqOffset.

The NTP logs have not been recorded consistently since the beginning of the project. Year 2010 data from May 3 to August 12th and Oct 14th to November 9th are available, as well as all data from April 9, 2011 onward.


Replacement of Garmin GPS

On April 12, 2011 the old Garmin GPS 25-HVS at the tower was replaced with a newer Garmin 18x-LVC model. The model numbers are shown in the \$PGRMT messages in the archive, where the time is UTC:

```
data_dump -i 1,30 -A manitou_20110412_120000.bz2 | fgrep PGRMT
...
2011 04 12 16:41:39.6568 0.15 49 $PGRMT,GPS 25-HVS VER 2.50 ,P,P,R,R,P,,23,R*08\r\n
2011 04 12 16:42:50.4248 0.1249 51 $PGRMT,GPS 18x-LVC software ver. 3.10,,,,,,,,*6D\r\n
```


Unexpectedly, the newer GPS provided much better time-keeping.

The following plot is for the old 25-HVS model for 3 days prior to the swap:

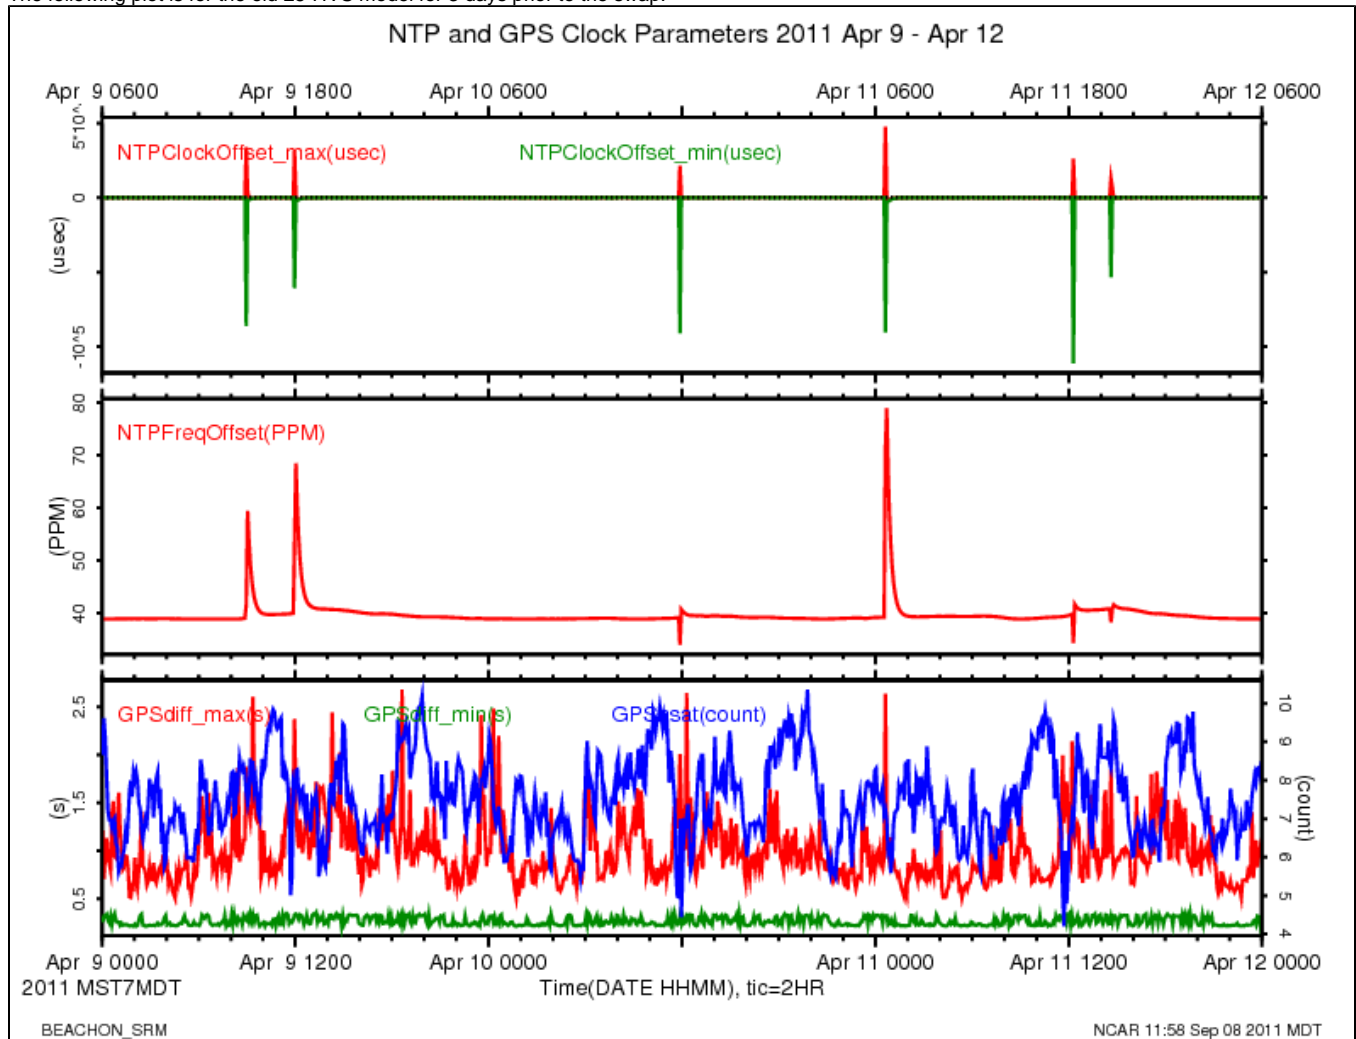


The NTPClockOffset shows spikes between -100000 to 50000 microseconds during this period, which is much worse than expected for a GPS/NTP reference clock. The spikes in NTPClockOffset are simultaneous with positive jumps in GPSdiff_max, up to as much as 2.5 seconds. These events seem to happen when the number of tracked satellites changes, which indicates that internal processing lags in the 25-HVS cause it to report late, causing large values of GPSdiff. The extent of this effect on the timing of the PPS signal is unknown.

The following plot shows a close up of one of the clock offset spikes using un-averaged data:

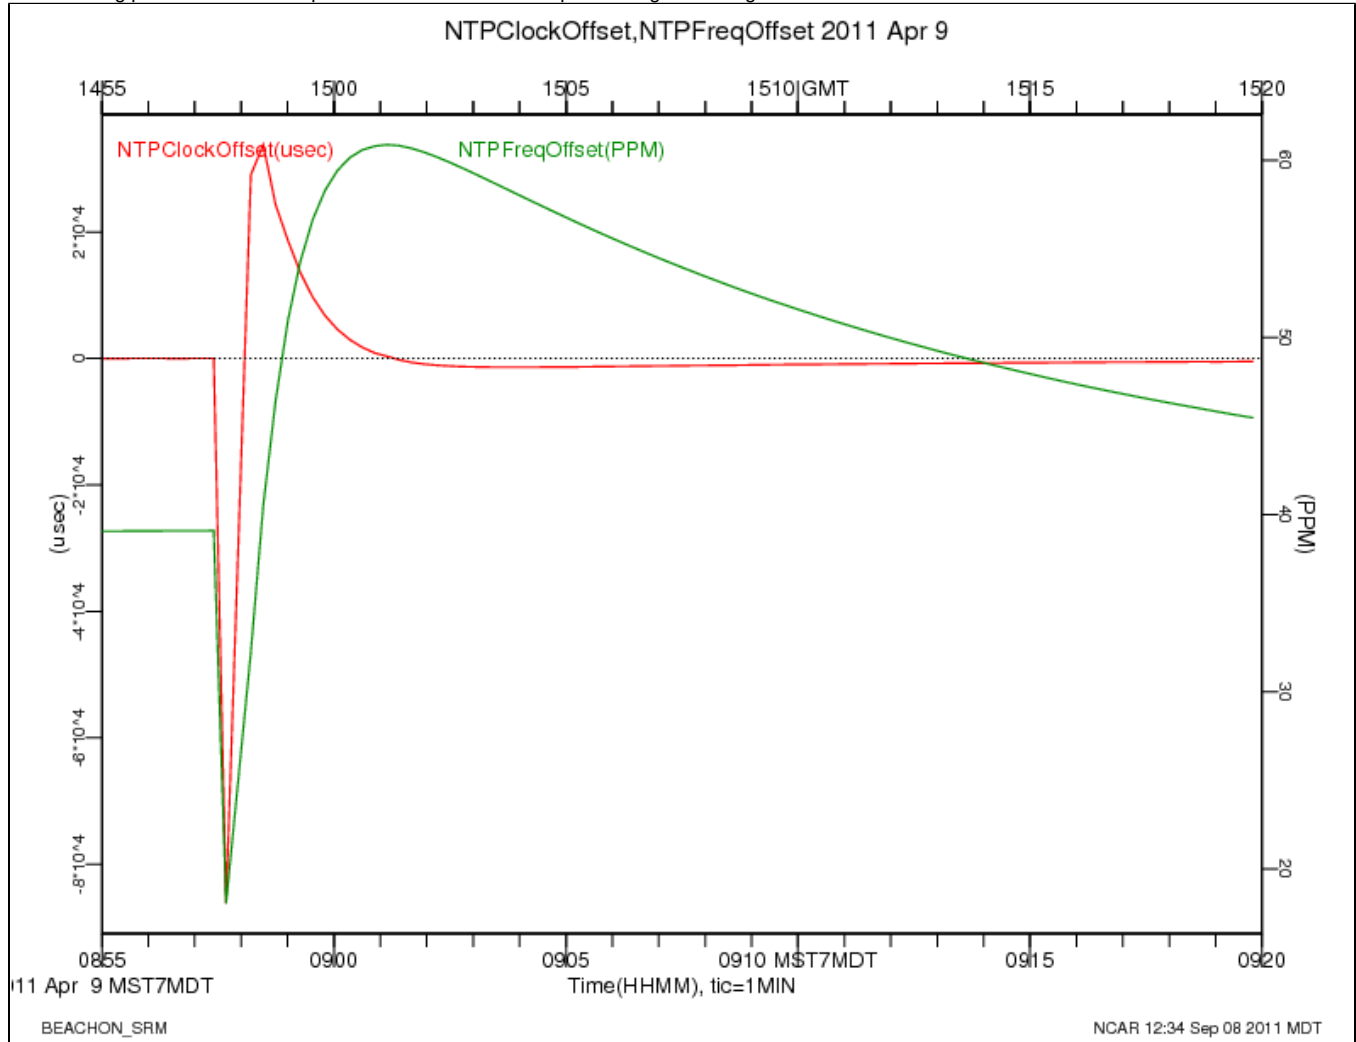

The sudden downward jump in NTPClockOffset causes NTP to think that the GPS clock is earlier than the system clock. NTP starts to correct for the offset by slowing down the system clock, as seen in the negative values for NTPFreqOffset. When the GPS recovers from its delayed reporting, NTP then sees positive values for NTPClockOffset and adjusts the system clock ahead.

After installing 18x-LVC, the NTPClockOffset is in a much improved range, from -70 to 25 microseconds. NTPFreqOffset is also in a much tighter range, indicating that NTP is applying smaller corrections to the system clock. GPSdiff is also much better behaved, ranging from a minimum of 0.5 to 1.1 seconds. The number of satellites tracked by the new GPS is also generally higher.

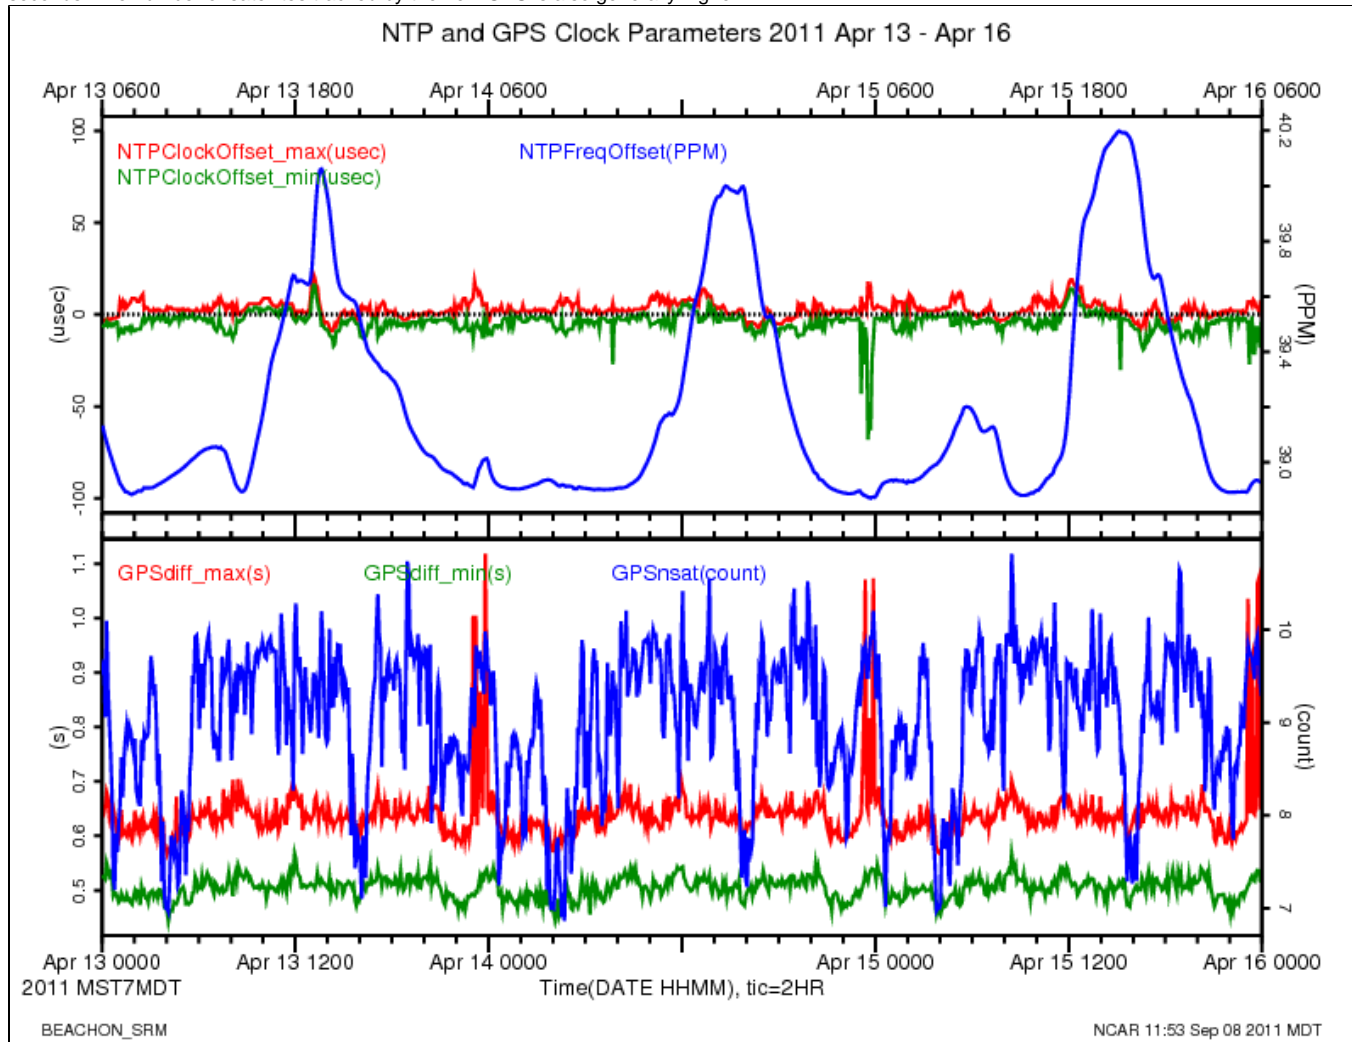


Temperature Effects

The frequency offset shows a temperature dependence in the system clock oscillator. We do not measure the temperature inside the data system enclosure, which is at the base of the tower. The nearest temperature measurement is of the ambient air at 2 meters up the tower. The top panel in the plot below shows a time series of the air temperature, along with NTPFreqOffset, for a cool 3 day period in April, after the installation of the new GPS. It appears that when the air temperature is below 5 deg C, the system clock oscillator does not show an obvious temperature relation.

The bottom panel shows a close relationship between the NTPClockOffset and the time derivative of NTPFreqOffset, which, I believe, indicates how NTP adjusts the system clock based on the measured offset. It also enforces the obvious conclusion that we could improve the time-keeping by insulating the CPU from temperature changes.


NTPFreqOffset,T.2m,NTPClockOffset,d_NTPFreqOffset_by_dt. 2011 Apr 13 - Apr 15

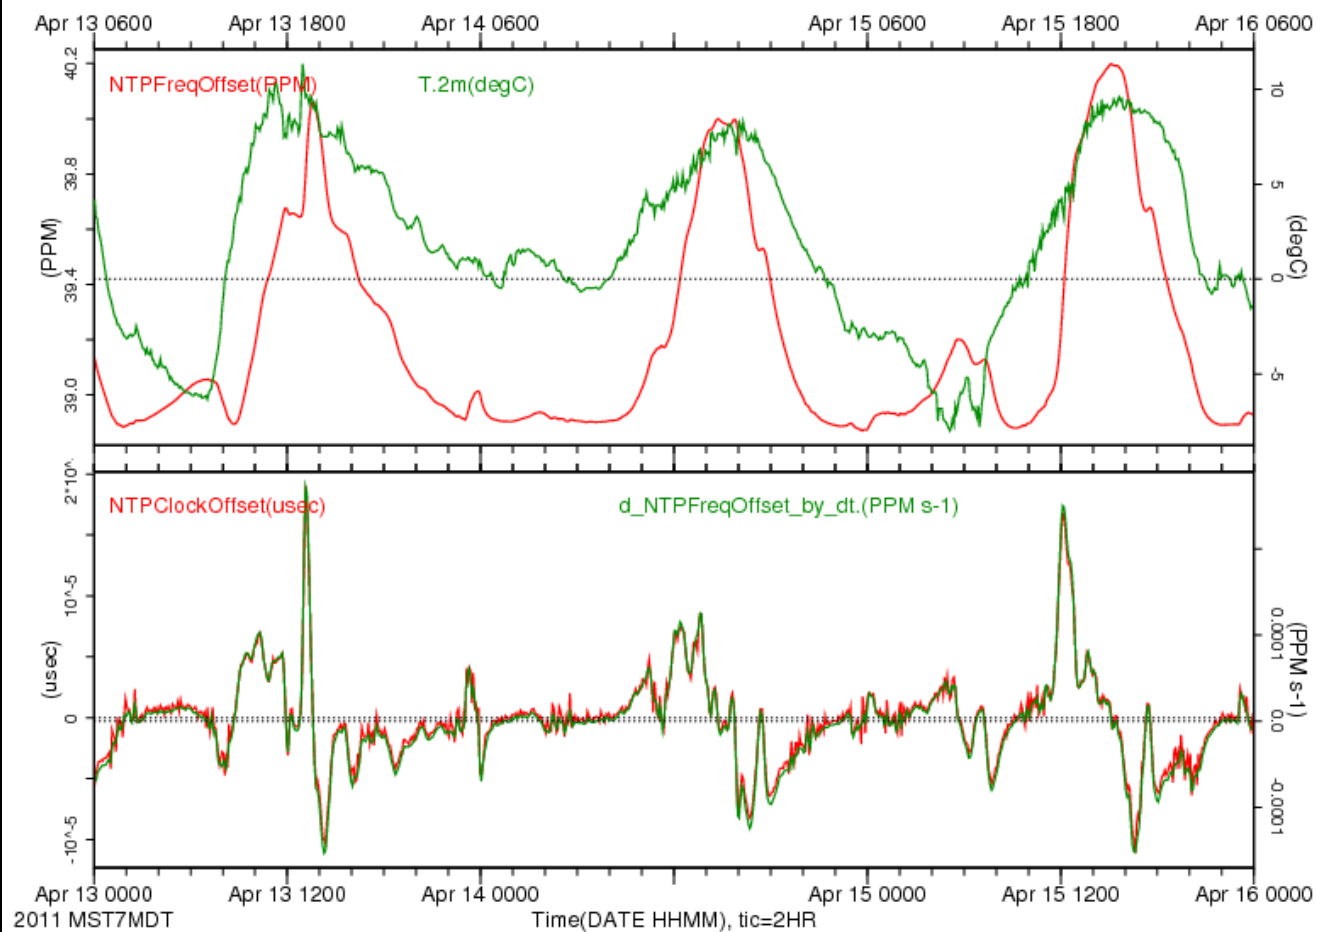

BEACHON_SRM

NCAR 12:45 Sep 08 2011 MDT

On a warmer 3 day period in July, where the temperatures were all above 5 degC, the temperature effect on the system clock oscillator is very evident.

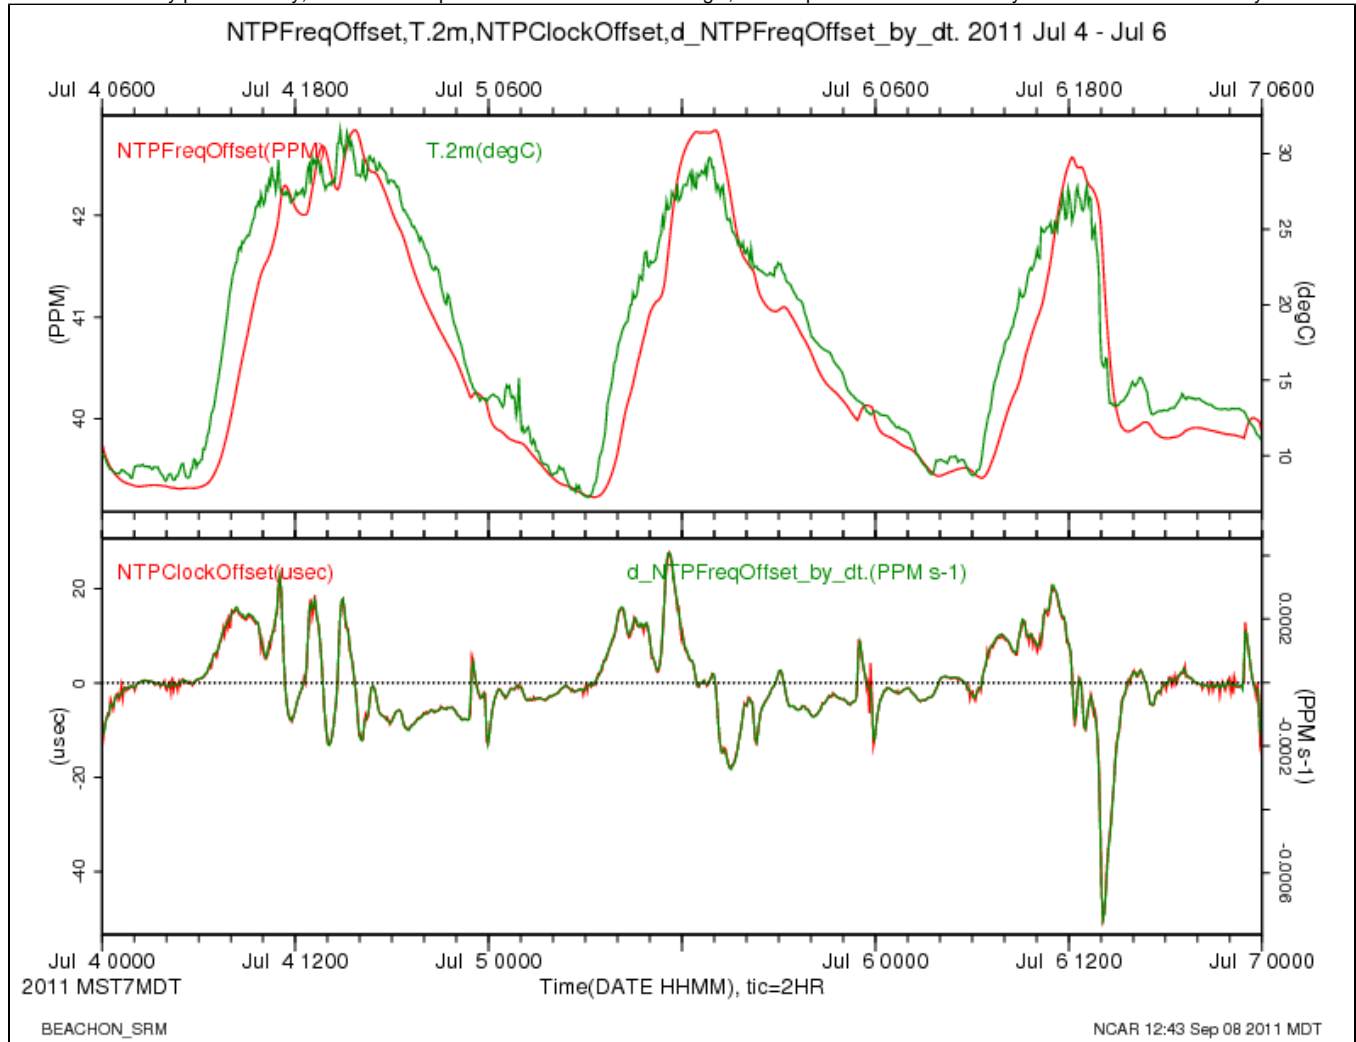


Time Offsets During File Transfers


The periodic spikes in GPSdiff_max up to 1 second that occur at 23:00 local time and last about an hour, are simultaneous with the network transfer of the day's data files from the DSM to the RAL server. These suggest that increased sample buffering and latency is happening at these times, which needs to be investigated and improved.

A close-up of the file transfer on April 14, 23:00, plotted below, shows several events where NTPClockOffset first has a negative spike, indicating that NTP has determined that the GPS clock is behind the system clock and starts to slow down the system clock. These down spikes appear to be due to a delay in the response to a PPS interrupt. The interrupt latency appears to be short lived, because the NTPClockOffset becomes positive, and the system clock is re-adjusted. The April 14 transfer is shown in this plot:

NTPClockOffset,NTPFreqOffset 2011 Apr 14 - Apr 15

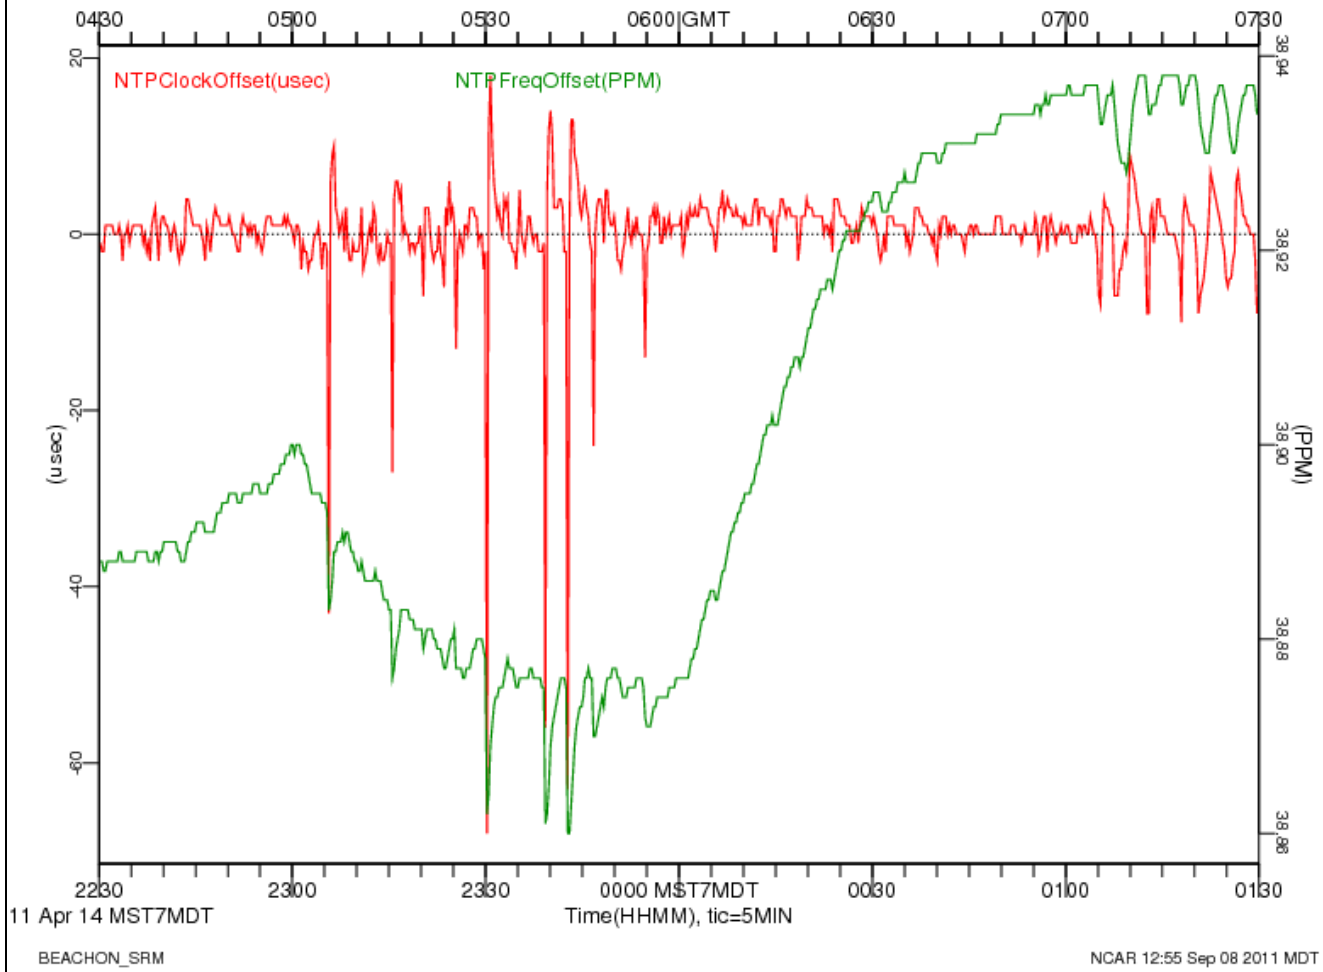

In July, the clock behaviour during the file transfer is similar, but the initial increase in NTPClockOffset and a rising slope in NTPFreqOffset might be due to increased heating of the system clock oscillator, due to increased CPU load during the file transfers. Wild conjecture? After a quick scan of the web plots of 5 minute averages, I think these positive bumps in NTPFreqOffset seem to occur during file transfers when the outside air temperatures are above 0 C, and don't occur in colder conditions.

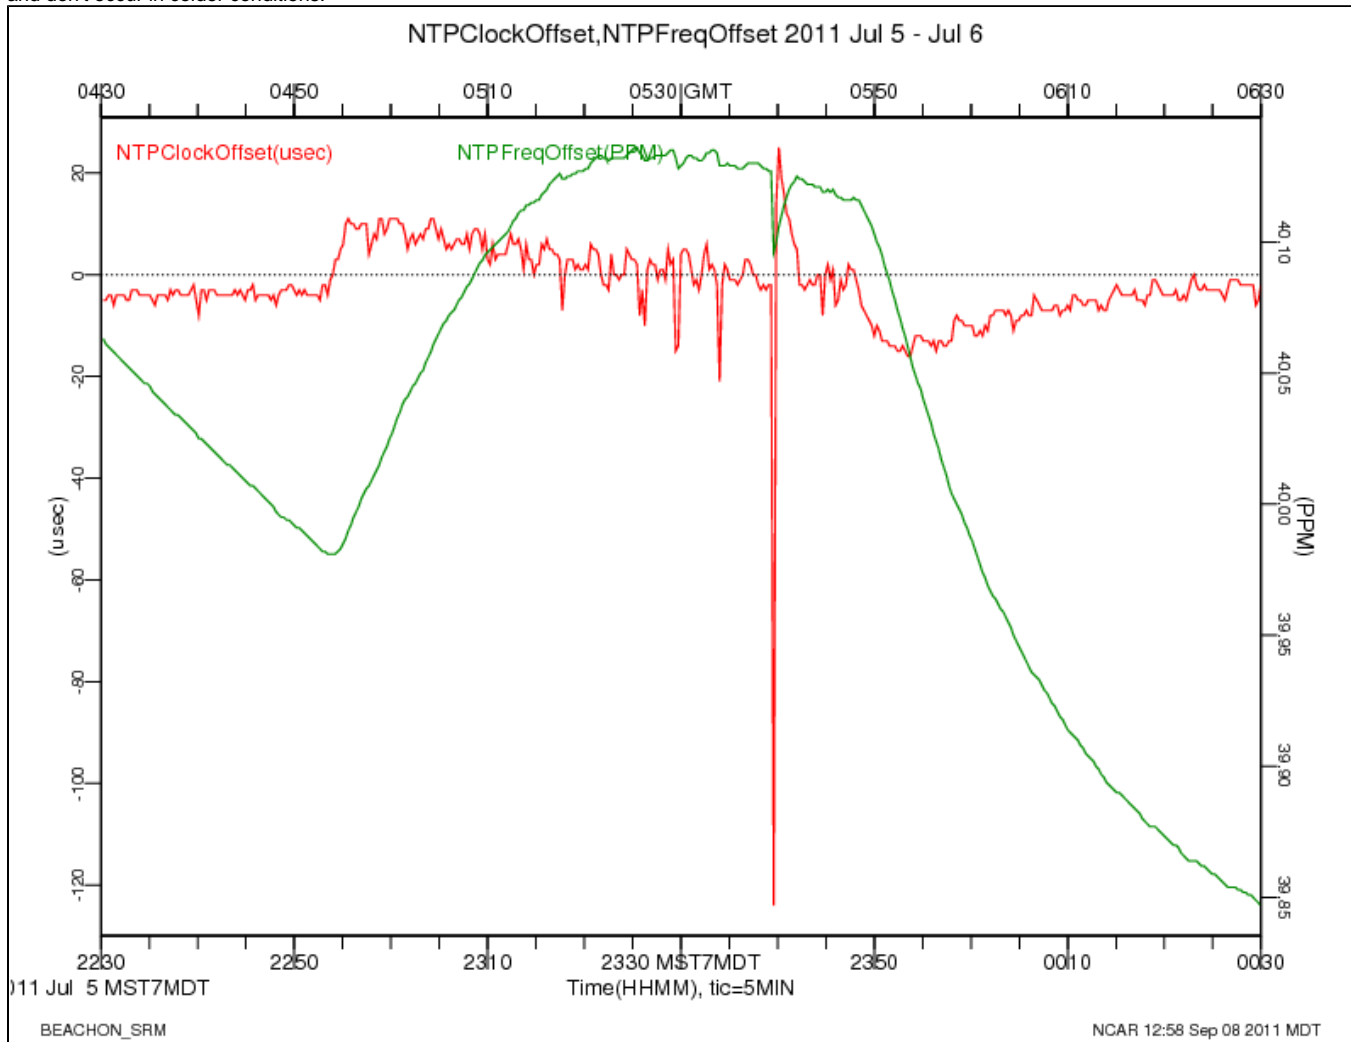

ppstest and ntpq

On the DSM, the ppstest program is helpful for gaining an understanding of the system and GPS clocks. It displays the system clock value when the interrupt function is called at the time of the assertion and the clear of the PPS signal. Do ctrl-C to terminate ppstest.

```
root@manitou root# ppstest /dev/ttyS3
trying PPS source "/dev/ttyS3"
found PPS source #3 "serial3" on "/dev/ttyS3"
ok, found 1 source(s), now start fetching data...
source 0 - assert 1315494544.999995675, sequence: 37249847 - clear 1315494544.099998000, sequence: 37249862
source 0 - assert 1315494544.999995675, sequence: 37249847 - clear 1315494545.099995000, sequence: 37249863
source 0 - assert 1315494545.999994675, sequence: 37249848 - clear 1315494545.099995000, sequence: 37249863
source 0 - assert 1315494545.999994675, sequence: 37249848 - clear 1315494546.099993000, sequence: 37249864
source 0 - assert 1315494546.999994675, sequence: 37249849 - clear 1315494546.099993000, sequence: 37249864
ctrl-C
```

The above sequence shows that the system clock is behind the GPS. The system time when the interrupt function is being called on the PPS assert is 5 microseconds before the exact second (0.999995). This corresponds to a NTPClockOffset of a positive 5 microseconds. This is confirmed with the ntpq program (which reports its offset in milliseconds):


```

root@manitou root# ntpq -p
      remote           refid      st t when poll reach   delay   offset  jitter
=====
xral          38.229.71.1        3 u  34   64  377    0.320    3.804    0.031
  LOCAL(0)      .LOCL.             10 l  93d   64   0    0.000    0.000    0.000
oGPS_NMEA(0)    .GPS.              2 l    6   16  377    0.000    0.005    0.031

```

The ntpq output indicates (with the leading 'o') that NTP is using the GPS as the system's reference clock. It also displays the offset of the RAL server's clock of 3.804 milliseconds, and indicates with an 'x' that it is not using that clock as a reference. The RAL server uses NTP over a WIFI connection to adjust its clock, so it is not as accurate as the DSM.

The loopstats file also shows the 5 usec offset at this time:

```

55812 54504.454 0.000005000 39.301 0.000030518 0.001408 4
55812 54520.455 0.000006000 39.302 0.000030518 0.001415 4
55812 54536.454 0.000005000 39.303 0.000030518 0.001392 4
55812 54552.454 0.000005000 39.305 0.000030518 0.001372 4

```

I do not believe I've seen a jitter value less than 31 microseconds. Not sure why that is. I believe the jitter is the standard deviation of the offset, but the NTP documentation is rather unclear to me.

- [turbtower](#)



[Updated 5 minute statistics in NetCDF](#)

Gordon Maclean posted on Aug 18, 2011

The 5 minute statistics of data from the turbulence tower, for the entire dataset, Jul 8 2009 to the present have been recomputed, and written to the NetCDF files. The new values incorporate the following changes:

- In each 20 Hz sample from a CSAT3 sonic, if any of the CSAT diagnostic bits are non-zero, then the values for that sample (u,v,w,tc) are marked as missing, and not added to the 5 minute statistics. This should result in better 5 minute statistics by excluding data when the transducer signals are poor, such as during rain.
- The calculation of the CSAT3 sonic diag value has changed. Previously the high-rate value could vary from 0 to 31, depending on which diagnostic bit was set. Now the high-rate diag value is just a 0 (no bits set) or 1 (one more more bits set), and the average is now the fraction of time in the 5 minute period that one or more diagnostic bits were set.
- The LICOR 7500's have a inherent sampling lag of 0.186 seconds, as documented in the manual from Licor. Our previous processing did not account for that lag when computing covariances between the sonic winds and the h2o and co2 from the Licor. This could result in increased values for the computed fluxes of water vapor and CO2.
- Units of CO2 have been changed from mmol/m^3 to g/m^3, the same as for H2O from the 7500s.

- [turbtower](#)
- [licor](#)
- [sonic](#)



[Check delay setting of Licors](#)

Gordon Maclean posted on Aug 15, 2011

Aug 15, 11:10 MDT

Logged into the DSM and checked that the Licor 7500 delay parameter was set to 0 on all units. Shut down the data process, and used minicom. Do "(Outputs ?)" to query the, and "(Outputs (BW 10))" to resume the licor output.

Conclusion: all Delay values were set to 0, as they should be.

```

adn
minicom ttyS2
ctrl-A w  (enable line wrap)
ctrl-A e  (enable echo)
ctrl-A f  (send break)
(Outputs ?)
(Outputs (BW 10))
ctrl-A q  (quit minicom)
aup

```

ttyS2, 2m:

```
Outputs (BW 10)(Delay 0)(SDM (Address 7))(Dac1 (Source NONE)(Zero 0)(Full 5))(Dac2 (Source NONE)(Zero 0)(Full 5))(RS232 (Baud 9600)(Freq 1e1)(Pres TRUE)(Temp TRUE)(Aux FALSE)(Cooler FALSE)(CO2Raw TRUE)(CO2D TRUE)(H2ORaw TRUE)(H2OD TRUE)(Ndx FALSE)(DiagVal TRUE)(DiagRec FALSE)(Labels FALSE)(EOL "0A")))
```

ttyS11, 16m:

```
(Outputs (BW 10)(Delay 0)(SDM (Address 7))(Dac1 (Source NONE)(Zero 0)(Full 5))(Dac2 (Source NONE)(Zero 0)(Full 5))(RS232 (Baud 9600)(Freq 1e1)(Pres TRUE)(Temp TRUE)(Aux FALSE)(Cooler FALSE)(CO2Raw TRUE)(CO2D TRUE)(H2ORaw TRUE)(H2OD TRUE)(Ndx FALSE)(DiagVal TRUE)(DiagRec FALSE)(Labels FALSE)(EOL "0A")))
```

ttyS17, 43m:

```
(Outputs (BW 10)(Delay 0)(SDM (Address 7))(Dac1 (Source NONE)(Zero 0)(Full 5))(Dac2 (Source NONE)(Zero 0)(Full 5))(RS232 (Baud 9600)(Freq 1e1)(Pres TRUE)(Temp TRUE)(Aux FALSE)(Cooler FALSE)(CO2Raw TRUE)(CO2D TRUE)(H2ORaw TRUE)(H2OD TRUE)(Ndx FALSE)(DiagVal TRUE)(DiagRec FALSE)(Labels FALSE)(EOL "0A")))
```

- [turbtower](#)
- [licor](#)



[Site Visit 07-29-2011](#)

[Chris Golubieski](#) posted on Aug 01, 2011

Arrived: 10:12am MDT

Departed: 1:45pm MDT

Ned and I did a couple of chores on this visit. First, we fixed the 43M sonic. It seemed to be the port on the Emerald Card. Switched 43M sonic from port16 to port20. Ned updated the xml. Second, we replaced two 15M cable from 43M Licor with a 30M cable. When we did this we noticed interrupts on the dsm. Having unplugged the battery charger for the laptop to talk with dsm, we plugged the charger back in and the dsm didn't give as much interrupts. [shrugging] Will keep an eye on this odd situation. Third, we clean all three Licors. Fourth, took guywire tensions.

Want to mention that there is a 2M tower just 15' South of the Turbulence Tower. WTF?

Also, there are no more ports on ethernet switch or 120AC power.

- [sonic](#)
- [dsm](#)
- [turbtower](#)



[43m sonic out](#)

[Gordon Maclean](#) posted on Jul 13, 2011

Ned noticed a drop out of data from 43 meters on Jul 10.

http://www.eol.ucar.edu/isf/projects/BEACHON_SRM/isfs/qcdata/plots/20110711/plots_all.shtml

I logged into the manitou data system on Jul 13, and tried to resurrect it.

I tried rserial, minicom and powering the sonic off and on:

```
eio 16 0
eio 16 1
rs 16
```

Got nutt'in

The licor is working. We compute its mean and higher moments in combination with the sonic data, so that if we don't have sonic data then we see no co2, co2'co2', w'co2', etc.

We do see the status values from the licor, and I rserial'd to it and see that it's working.

- [turbtower](#)
- [sonic](#)




[43m RH bad](#)

Gordon Maclean posted on Jun 03, 2011

RH at 43m has been bad for a while. Looking back through the plots, looks like it failed the night of Apr 25 during a period of near 100% RH.

http://www.eol.ucar.edu/isf/projects/BEACHON_SRM/isfs/qcdata/plots/20110425/trh_20110425.png

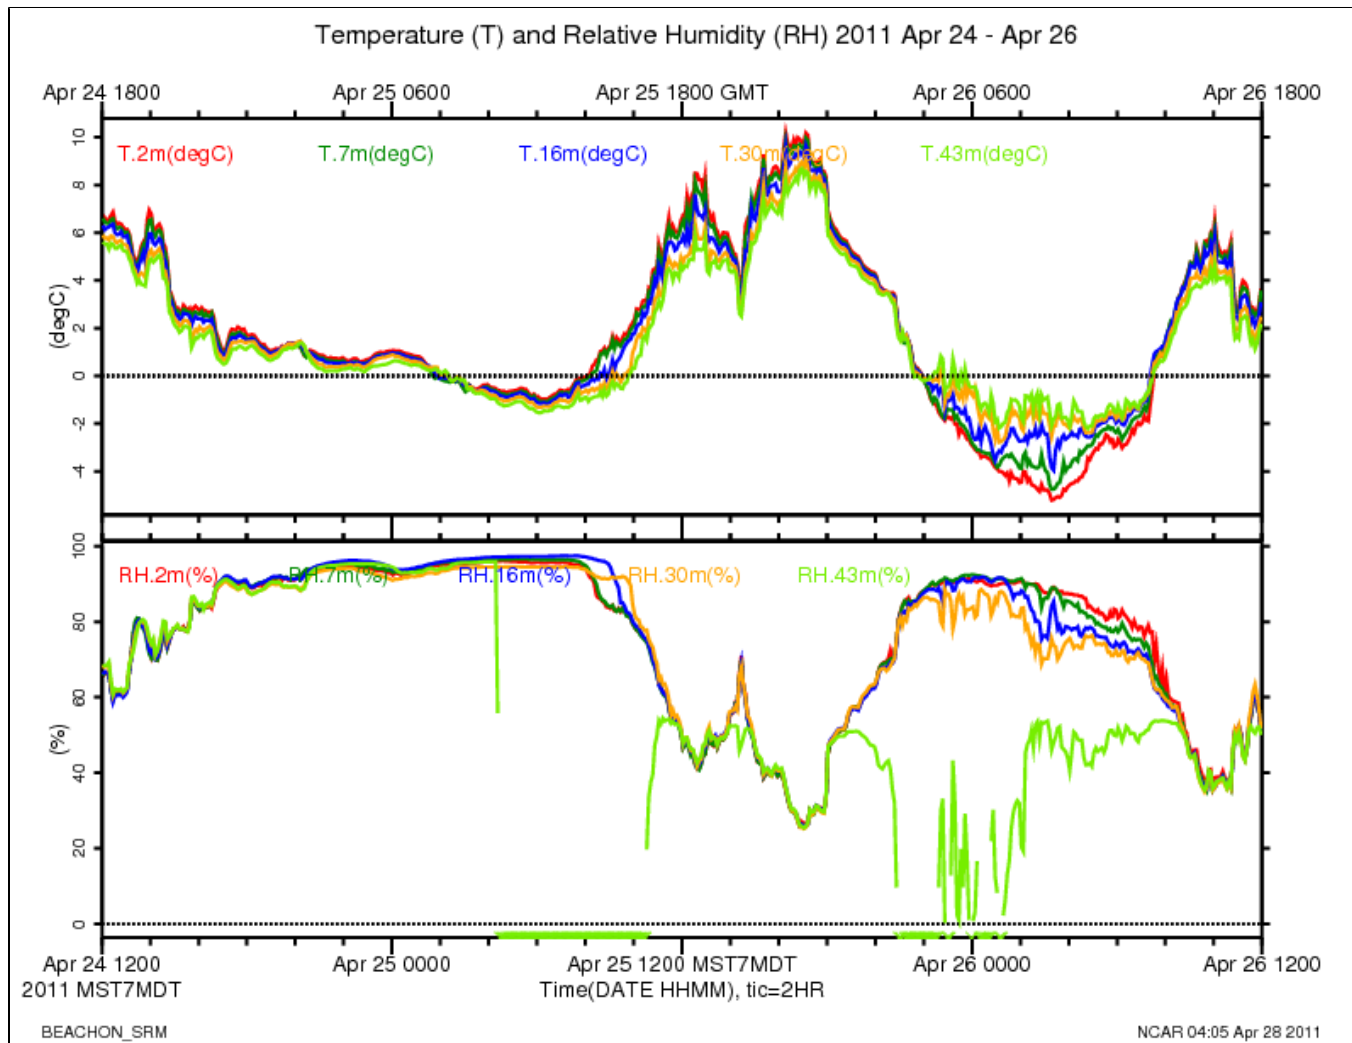

- [turbtower](#)
- [trh](#)



[bungled data event](#)

Gordon Maclean posted on May 24, 2011

The plot of GPSdiff_max for May 22, 2011 shows a maximum value of around 25 seconds between 11:05 and 17:00 UTC, indicating something went haywire with the data collection during those times.

Looking at the downloaded data, it appears that data stopped coming in on the Diamond serial ports at 11:05, and resumed at 17:00. There is not a large gap in data from the 3 sensors that are sampled on the Viper serial ports, but they show large time tag delta-Ts, followed by many small delta-Ts, symptomatic of the system getting behind and having to do major buffering. Perhaps a "storm" of interrupts from the Diamond that finally cleared up? Moisture somewhere?

I don't have time to look into it at this time, but here are some dumps of data around the problem.

```
data_stats /scr/isfs/projects/BEACHON_SRM/raw_data/manitou_20110522_000000.dat
2011-05-24,16:56:30|INFO|opening: /scr/isfs/projects/BEACHON_SRM/raw_data/manitou_20110522_000000.dat
EOFException: /scr/isfs/projects/BEACHON_SRM/raw_data/manitou_20110522_000000.dat: open: EOF
sensor dsm sampid nsamps |----- start -----| |----- end -----| rate minMaxDT(sec) minMaxLen
1 20 39901 2011 05 22 00:00:00.998 05 22 11:05:01.461 1.00 0.336 1.643 19 19
1 30 84632 2011 05 22 00:00:00.571 05 22 11:59:59.719 1.96 0.042 26.076 51 73
1 100 843525 2011 05 22 00:00:00.160 05 22 11:59:59.944 19.53 -2.052 27.951 12 16
1 110 415176 2011 05 22 00:00:00.113 05 22 11:59:59.959 9.61 -2.016 28.058 39 87
1 120 41042 2011 05 22 00:00:00.185 05 22 11:05:01.388 1.03 0.294 1.643 29 31
1 200 798028 2011 05 22 00:00:00.166 05 22 11:05:01.873 20.00 0.005 0.596 12 12
1 220 40687 2011 05 22 00:00:00.791 05 22 11:05:01.158 1.02 0.357 1.604 28 29
1 300 798048 2011 05 22 00:00:00.168 05 22 11:05:01.884 20.00 0.002 0.585 12 12
1 310 399023 2011 05 22 00:00:00.000 05 22 11:05:01.841 10.00 0.042 0.454 44 49
1 320 40488 2011 05 22 00:00:00.233 05 22 11:05:01.428 1.01 0.356 1.613 28 29
1 330 7981 2011 05 21 23:59:55.213 05 22 11:04:55.250 0.20 4.415 5.586 49 60
1 400 798041 2011 05 22 00:00:00.005 05 22 11:05:01.883 20.00 0.001 0.591 12 12
1 420 40772 2011 05 22 00:00:00.328 05 22 11:05:01.192 1.02 0.344 1.614 29 30
1 500 798042 2011 05 22 00:00:00.171 05 22 11:05:01.913 20.00 0.002 0.603 12 12
1 510 399020 2011 05 22 00:00:00.007 05 22 11:05:01.814 10.00 0.037 0.436 44 49
1 520 40747 2011 05 22 00:00:00.342 05 22 11:05:01.149 1.02 0.372 1.588 27 29

[maclean@porter ~]$ data_stats /scr/isfs/projects/BEACHON_SRM/raw_data/manitou_20110522_120000.dat
2011-05-24,16:57:04|INFO|opening: /scr/isfs/projects/BEACHON_SRM/raw_data/manitou_20110522_120000.dat
EOFException: /scr/isfs/projects/BEACHON_SRM/raw_data/manitou_20110522_120000.dat: open: EOF
sensor dsm sampid nsamps |----- start -----| |----- end -----| rate minMaxDT(sec) minMaxLen
1 20 25156 2011 05 22 17:00:47.215 05 22 23:59:59.960 1.00 0.019 1.371 19 29
1 30 73288 2011 05 22 12:00:25.745 05 22 23:59:59.741 1.70 0.104 26.116 51 73
1 100 750227 2011 05 22 12:00:28.065 05 22 23:59:59.959 17.38 -2.052 27.951 12 16
1 110 337790 2011 05 22 12:00:28.120 05 22 23:59:59.922 7.82 -2.016 28.058 17 69
1 120 25895 2011 05 22 17:00:47.289 05 22 23:59:59.553 1.03 0.029 1.756 29 38
1 200 502634 2011 05 22 17:01:05.737 05 22 23:59:59.999 20.00 0.000 2.518 2 466
1 220 25715 2011 05 22 17:00:47.290 05 22 23:59:59.392 1.02 0.028 1.594 28 39
1 300 502351 2011 05 22 17:01:20.419 05 22 23:59:59.968 20.00 0.000 2.538 2 465
1 310 251531 2011 05 22 17:00:47.284 05 22 23:59:59.926 10.00 0.050 0.154 44 66
1 320 25590 2011 05 22 17:00:47.291 05 22 23:59:59.734 1.02 0.028 1.315 28 39
1 330 5032 2011 05 22 11:05:00.251 05 22 23:59:50.264 0.11 0.061 21347.049 6 61
1 400 502055 2011 05 22 17:01:35.059 05 22 23:59:59.987 20.00 0.001 2.508 3 466
1 420 25769 2011 05 22 17:00:47.292 05 22 23:59:59.864 1.02 0.029 1.523 29 37
1 500 502936 2011 05 22 17:00:45.341 05 22 23:59:59.998 19.99 0.003 4.123 12 466
1 510 251530 2011 05 22 11:05:01.916 05 22 23:59:59.963 5.41 0.027 21345.401 43 50
1 520 25730 2011 05 22 17:00:47.294 05 22 23:59:59.423 1.02 0.028 1.631 26 39
```

Data kept coming in on the Viper serial ports (ids=30,100,110, GPS, sonic and licor at 2m), but had time tag issues, apparently because buffers filled up. Here's a snippet of the 2m sonic data in hex, showing a 28 second time tag jump, but no skip in the sonic sequence (byte 9: f8,f9,fa,fb,fc, etc)

```
2011 05 22 11:05:53.8243 0.05004 12 20 06 0b 03 39 ff 6e e8 f5 0f 55 aa
2011 05 22 11:05:53.8743 0.04997 12 6a 06 0f 03 1b ff 6a e8 f6 0f 55 aa
2011 05 22 11:05:53.9243 0.05002 12 bf 05 b1 02 de fe 69 e8 f7 0f 55 aa
2011 05 22 11:05:53.9743 0.04998 12 4d 05 cb 02 d0 fe 6e e8 f8 0f 55 aa
2011 05 22 11:06:21.9147 27.94 12 35 05 d6 02 df fe 71 e8 f9 0f 55 aa
2011 05 22 11:06:21.9272 0.0125 12 03 06 7f 03 30 ff 6f e8 fa 0f 55 aa
2011 05 22 11:06:21.9397 0.0125 12 32 06 7f 03 98 ff 65 e8 fb 0f 55 aa
2011 05 22 11:06:21.9522 0.0125 12 46 05 59 02 35 ff 6d e8 fc 0f 55 aa
2011 05 22 11:06:21.9647 0.0125 12 83 05 1a 03 c3 fe 75 e8 fd 0f 55 aa
```

After the gap, the 0.0125 dTs result from unpacking multiple samples from a buffer, where the code computes a dT = 10 bits/byte / (9600 bits/sec) * 12 bytes/sample = 0.0125 sec/sample

I see no indication of a problem in the system logs, or any weird clock adjustments in the NTP loopstats,peerstats.

[1 Comment](#)

- [turbtower](#)
- [data-system](#)



[Tower Visit 04-12-2011](#)

[Chris Golubieski](#) posted on Apr 13, 2011

Arrived: 10:30am MDT

Departed: 11:20am MDT

Kurt and I installed three LiCors on turbulence tower at heights of 2M, 15M and 45M. TRHs were installed on all levels. New GPS was added and old Garmin was removed.

LiCor heights:

2M-1166

15M-1163

45M-1164

- [licor](#)
- [gps](#)
- [trh](#)
- [turbtower](#)



[Licor 7500 settings](#)

[Gordon Maclean](#) posted on Apr 12, 2011

Apr 12, 11:32 am

The output format and reporting rate of the 3 Licor 7500s that were re-installed today had been reset during the calibration procedure to generate verbose output, with labels. To save archive space, we configure the units for a terse output, without labels, at 10 Hz.

To setup the Licors for the format that our data system expects, do the following from the data system login prompt:

1. shut down the data process
adn
2. run minicom on the Licor port (ttyS2=2m, ttyS7=7m, ttyS11=16m, ttyS14=30m, ttyS17=43m)
minicom ttyS2
3. If the baud rate agrees with minicom (9600) you should see the default Licor output
4. Send a break character, by doing "control-A f" from minicom
ctrl-Af
5. Send these strings to the Licor:

```
(Outputs (RS232 (EOL "0A") (Labels FALSE) (DiagRec FALSE) (Ndx FALSE) (Aux FALSE) (Cooler FALSE)
(CO2Raw TRUE) (CO2D TRUE) (H2ORaw TRUE) (H2OD TRUE) (Temp TRUE) (Pres TRUE) (DiagVal TRUE)))
(Outputs (BW 10) (Delay 0) (RS232 (Freq 10.0) (Baud 9600)))
(Outputs (Dac1 (Source NONE)(Zero 0)(Full 5)) (Dac2 (Source NONE)(Zero 0)(Full 5)))
```

6. You won't see much output, perhaps just 1 column of digits on the right-hand-side, since the Licor is sending just a line-feed termination and no carriage-return. You can turn on line wrap in minicom, with "control-A w" to see the data stream wrap from side to side:
ctrl-Aw
7. Exit minicom with control-A q
ctrl-Aq
8. restart the data process:
aup
9. check the Licor data with rserial. It may take 30 seconds or so for the data system to open the port. During that time rserial will report an error about not finding the sensor. Eventually it should work.
rs 2
10. The data should look like:

```
248\t0.06460\t12.4193\t0.01218\t81.586\t16.10\t76.1\t\n
248\t0.06462\t12.4179\t0.01207\t81.459\t16.11\t76.1\t\n
```

11. Exit rserial with control-D
ctrl-d

- [turbtower](#)
- [licor7500](#)



LiCors Calibration 04-05-2011

Chris Golubieski posted on Apr 07, 2011

Calibration process for LiCors 7500s. I calibrated all five LiCors. Calibration included post cal, desiccant change, spot check, zero/span. I used N2 tank which went through a scrubber of Ascarite II and Drierite to give the zero for both CO2 and H2O.

Post-Cal conditions were checking zeros, span and dew point. Spans included for CO2 were a bottle of 394.611ppm and 378.867ppm. For H2O I used the Thunder Scientific, humidity chamber, set at 25C at 80%RH. Dew point was equal to 21.31C.

Zero Post-Conditions: Pressure 85.04kPa, Temp=27.3C

| Sensor ID | CO2(umol/mol) | H2O(mmol/mol) | CO2 Coeff.(zero/span) | H2O Coeff.(zero/span) |
|-----------|---------------|---------------|-----------------------|-----------------------|
| 0813 | 0.08 | 1.11 | N/A | N/A |
| 1166 | 6.58 | -1.59 | 0.8896/1.0051 | 0.8583/0.9969 |
| 1163 | -7.90 | 0.24 | 0.8709/1.0082 | 0.8510/1.0229 |
| 1167 | -3.23 | -0.15 | 0.8770/1.0207 | 0.8732/0.9986 |
| 1164 | -10.80 | 0.43 | 0.8902/1.0233 | 0.8635/1.0008 |

Span Post-Conditions: Column2 is standard 394.611ppm; Column3 is standard 378.867ppm; Column4 is dew point standard 21.31C

| Sensor ID | CO2(ppm) | CO2(ppm) | H2O(C) | |
|-----------|----------|----------|--------|--|
| 0813 | ----- | ----- | ----- | |
| | - | - | - | |
| 1166 | 400.83 | 387.48 | 21.16C | |
| 1163 | 389.02 | 373.09 | 22.07 | |
| 1167 | 398.17 | 382.72 | 20.93 | |
| 1164 | 389.60 | 373.81 | 21.82 | |

Quick Check after desiccant was changed and ran for overnight. Pressure 82.62kPa, Temp 24.33C

| Sensor ID | CO2 (ppm) | H2O (C) | CO2(378.867 ppm) |
|-----------|-----------|---------|------------------|
| 0813 | ----- | ----- | ----- |
| 1166 | 6.61 | ----- | ----- |
| 1163 | -6.05 | 0.41 | ----- |
| 1167 | -2.35 | ----- | ----- |
| 1164 | -6.61 | 0.43 | 380.54 |

Zero Calibration: CO2 and H2O were set to zero value.

| Sensor ID | CO2 (ppm) | H2O (ppm) | CO2 Coeff. | H2O Coeff. |
|-----------|-----------|-----------|------------|------------|
| 0813 | -0.01 | 0.00 | 0.9752 | 0.7374 |
| 1166 | -0.03 | 0.00 | 0.8909 | 0.8605 |
| 1163 | -0.01 | 0.00 | 0.8698 | 0.8532 |
| 1167 | 0.01 | 0.00 | 0.8766 | 0.8749 |
| 1164 | 0.01 | 0.00 | 0.8889 | 0.8662 |

Span Calibration: CO2 was spanned to 394.611ppm; H2O was spanned to dew point 21.31C.

| Sensor ID | CO2 (ppm) | H2O (ppm) | CO2 Coeff. | H2O Coeff. |
|-----------|-----------|-----------|------------|------------|
| 0813 | 394.43 | 21.43 | 0.9936 | 1.0380 |
| 1166 | 394.43 | 21.44 | 1.0052 | 1.0497 |
| 1163 | 394.65 | 21.45 | 0.9950 | 1.0211 |
| 1167 | 394.84 | 21.41 | 1.0049 | 1.0258 |
| 1164 | 394.56 | 21.42 | 1.0008 | 1.0206 |

- licor
- turbtower




Post cal results on TRH

Steven Semmer posted on Apr 05, 2011


The TRH sensors went through a post cal check before re-calibration.

Here are the results.

Temperature: Tested over the range of -30 to 30. It has been almost 1 year since these sensors were calibrated

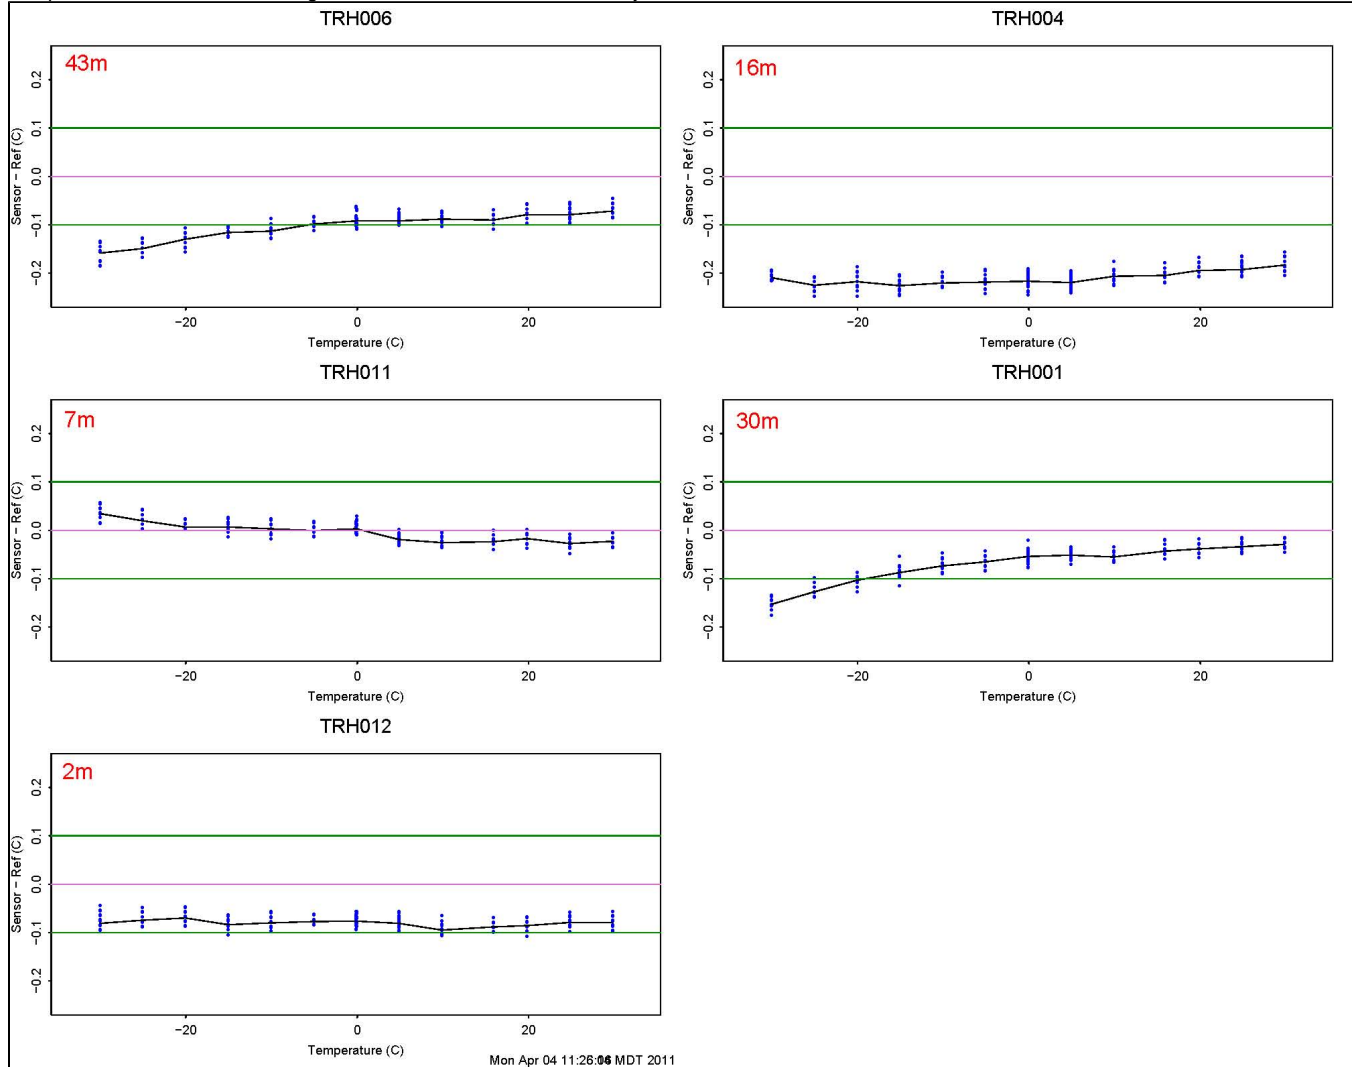

Relative Humidity: Tested over 10% to 90% at temperatures 25, 10, -3

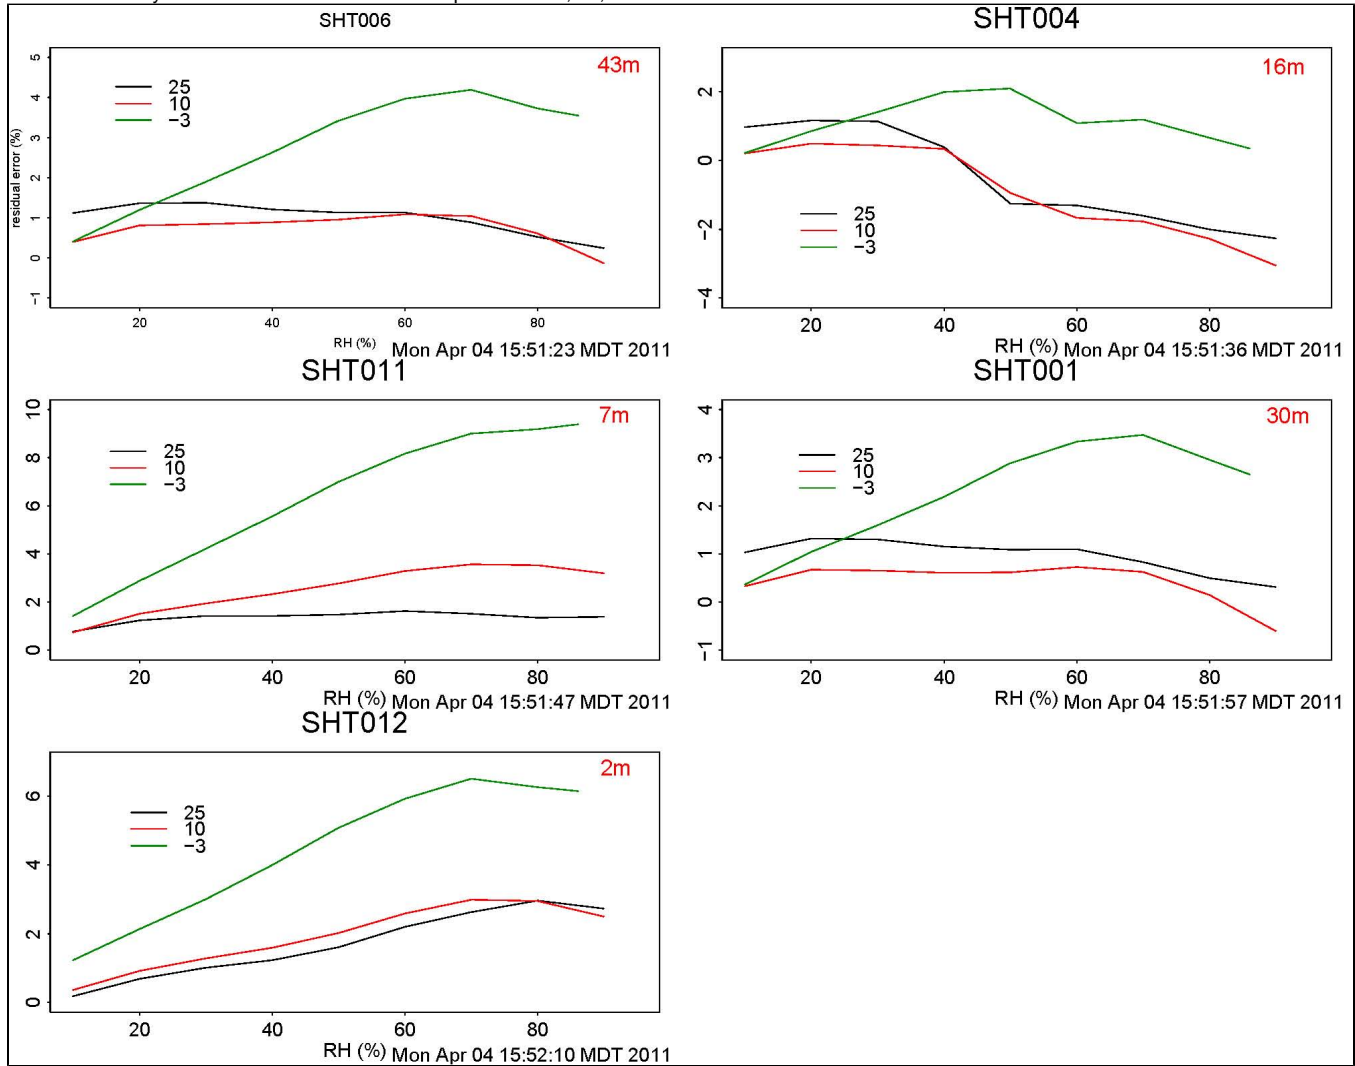

- [turbtower](#)
- [trh](#)



[Licor 7500, TRH removed](#)

Steven Semmer posted on Apr 05, 2011

The Licor 7500 and TRH sensors were removed on 3/29. They will be re-calibrated and re-installed in about 2 weeks.

- [licor](#)
- [trh](#)
- [turbtower](#)



[LiCors and TRHs Removed 03-29-2011](#)

Chris Golubieski posted on Mar 30, 2011

So sorry. This is a redundant log entry. First entry was in the main Manitou Log entry page.

Attendees: Chris, Kurt and Ned.

Arrived at 11:25am

Departed at 1:15pm

Removed LiCors and TRHs at all heights. The LiCors were at the following heights.

2m: s/n 1163

7m: s/n 1166

15m: s/n 1167

45m: s/n 1164

We unplugged main power to all LiCors in the battery boxes. Replaced both outside GFI outlets. Both outlets were blown. Power back to both outlets. Beacon back on.

- [turbtower](#)
- [licor](#)
- [trh](#)
- [licor7500](#)
- [co2](#)



[Updated NIDAS software, NTP server](#)

[Gordon Maclean](#) posted on Oct 14, 2010

Installed the latest version of nidas (revision 5771M) today, with the new process running at 19:49 UTC.

The new nidas has some improvements in the serial handling efficiency. Don't see any effect on the number of "spurious interrupts" though.

Also restarted ntp daemon. Added a "server ral" entry in /etc/ntp.conf so that we can compare our local GPS time source with the ral server.

ntpq -p shows good agreement (-8.285 millisecond offset) with the ral server:

```
ntpq -p
      remote          refid      st t when poll reach  delay  offset  jitter
=====
xral          208.75.88.4        3 u   7   64  377    0.368   -8.285   1.249
oGPS_NMEA(0)   .GPS.                2 l  15   16  377    0.000   -0.028   0.031
```

Querying the ral ntp server, with **ntpq -p ral** shows that it has offsets with its servers, probably related to the big delays over its wifi connection:

```
ntpq -p ral
      remote          refid      st t when poll reach  delay  offset  jitter
=====
+64.6.144.6    128.252.19.1        2 u  300 1024  177   43.800  -32.309  12.143
*208.75.88.4   192.12.19.20        2 u  997 1024  377   56.151   16.212   0.321
+64.73.32.134  192.5.41.41         2 u  502 1024  377   42.897    7.307 110.558
```

Later, Oct 16, 15:24 MDT, saw smaller offsets all around:

```
root@manitou root# ntpq -p
      remote          refid      st t when poll reach  delay  offset  jitter
=====
xral          208.75.88.4        3 u   39   64  377    0.354    1.108   0.390
oGPS_NMEA(0)   .GPS.                2 l    -   16  377    0.000    0.003   0.031
root@manitou root# ntpq -p ral
      remote          refid      st t when poll reach  delay  offset  jitter
=====
+64.6.144.6    128.252.19.1        2 u  135 1024  373   41.912    0.464  74.268
*208.75.88.4   192.12.19.20        2 u  840 1024  357   56.112    2.963   1.735
+64.73.32.134  192.36.143.150      2 u  317 1024  377   39.507    1.365  64.459
```

- [data-system](#)
- [turbtower](#)



[7m TRH intermittent](#)

[Gordon Maclean](#) posted on Oct 06, 2010

Data from the 7m TRH has been intermittent for more than a month.

Here's a typical dropout, where the unit quits reporting, then 15 hours later comes alive, with startup messages:

```
2010 10 02 14:07:54.4656      0      40 \x00\x00\r Sensor ID16      data rate: 1 (secs)\n
2010 10 03 05:28:49.2103 5.525e+04      29 \rcalibration coefficients:\r\n
2010 10 03 05:28:49.2517 0.04144      21 Ta0 = -4.042937E+1\r\n
2010 10 03 05:28:49.2827 0.03095      21 Ta1 = 1.022852E-2\r\n
2010 10 03 05:28:49.3134 0.0307      21 Ta2 = -2.096747E-8\r\n
2010 10 03 05:28:49.3445 0.0311      21 Ha0 = -1.479133E+0\r\n
2010 10 03 05:28:49.3773 0.03286      21 Ha1 = 3.554063E-2\r\n
2010 10 03 05:28:49.4057 0.02836      21 Ha2 = -1.382833E-6\r\n
2010 10 03 05:28:49.4390 0.03329      21 Ha3 = 3.354407E-2\r\n
2010 10 03 05:28:49.4693 0.03031      21 Ha4 = 3.666422E-5\r\n
2010 10 03 05:28:49.8050 0.3357      29 TRH16 4.91 94.96 4474 3057\r\n
```

Email from Ned:

the TRH at 7m now seems to be re-appearing during the night time and then at about 8am it drops out again...

http://www.eol.ucar.edu/isf/projects/BEACHON_SRM/isfs/qcdata/plots/20101001/Tprof_20101001.png

My guess is that it is a power problem, either in the cable, or corrosion in the unit. This unit and cable was replaced on 7/22. The problem before was different, looking like a RS232 problem, where I don't think we saw the bootup messages we're seeing now. <https://wiki.ucar.edu/x/vBWdAw>

- [turbtower](#)
- [trh](#)



[repl 7m trh sensor, cables, re-tensioned tower](#)

[Kurt Knudson](#) posted on Aug 20, 2010
7/22/10

re-tensioned all guy wires using transits to plumb tower.

replaced 7m and 15m trh cables, as well as 7m trh sensor

- [turbtower](#)
- [trh](#)
- [data-system](#)
- [datasystem](#)



[2m Licor working again](#)

[Gordon Maclean](#) posted on Jul 18, 2010

The Licor 7500 at 2m has not been reporting for a while.

Looking at /proc/tty/driver/serial for port 2 indicates that no characters have been received since the last reboot. As of Jul 18 the system uptime is 19 days.

Did "rs 2" to talk to the port. After sending carriage a return the 7500 responds with

```
^M(Error (Received TRUE))\n
```

So, it is alive and responding, just not sending data. Sent it a configuration command, setting the BW and RS232 parameters, which got it going again:

```
(Outputs (BW 10) (RS232 (Freq 10.0) (Baud 9600)))
```

It responded with the following and then started streaming data:

```
(Ack (Received TRUE)(Val 0))
```

Looks like it didn't come up in continuous reporting mode for some reason - either after a power outage, or after receiving some glitch characters on its input.

There may be a better command to get it going again once it has been interrupted. I just knew from prior experience that the above works. Probably just a "(Outputs)" or "(Outputs (BW 10))" would also work.

- [turbtower](#)
- [licor7500](#)



[Turbulence tower data system clock behind by 1 second from May 4 - Jun 11](#)

Gordon Maclean posted on Jul 15, 2010

The turbulence tower data system clock was behind by 1 second from May 4 to Jun 11. If sub-second absolute time-tag accuracy of the data samples is a not a concern, then you can ignore this log message. Otherwise, here are the gory details...

The data system was replaced on the turbulence tower on May 4.

The new system is running a new version (4.2.6p1) of the NTP (network time protocol) service. NTP on the data system is configured to use the attached GPS (Garmin 25-HVS) as a reference clock. NTP reads the NMEA messages from the GPS, which contain the absolute time, at a precision of a second, and it monitors the PPS (pulse-per-second) signal from the GPS. The leading edge of the PPS has approximate 1 microsecond absolute accuracy. Using the two inputs, NTP can condition the embedded data system clock to an absolute accuracy which is typically better than 300 microseconds.

The NMEA messages from the 25-HVS have a roughly 0.4 - 0.8 second lag, meaning the NMEA message for 00:00:00 arrives at the data system between 0.4 and 0.8 seconds late, at sometime after 00:00:00.4

The new version of NTP must be passed a parameter, known as "time2", specifying the approximate lag in seconds of the NMEA messages. If the value is left as the default, 0.0, then NTP assigns the time of a PPS with the time of the most recently received NMEA message, which results in a Linux system clock that is exactly 1 second behind absolute time.

On Jun 11 I detected this issue when fiddling with a data system in the FLAB parking lot, where I also had access to a NTP server on the network.

Here's the last 2 points of data from the GPS on the old system on May 4 at 18:33:34 UTC. There is a gap of 3848 seconds while the data system was swapped out, and the first 2 GPS data points from the new system at 19:37:42.

```
data_dump -i 1,30 -A manitou_20100504_120000.bz2 | more
...
2010 05 04 18:33:34.7163 1.127 73 $GPRMC,183334,A,3906.0321,N,10506.3310,W,000.0,289.2,040510,010.5,
E*60\r\n
2010 05 04 18:33:34.8746 0.1583 72 $GPGGA,183334,3906.0321,N,10506.3310,W,1,06,1.7,2396.4,M,-21.3,M,,
*46\r\n
2010 05 04 19:37:42.3816 3848 73 $GPRMC,193743,A,3906.0352,N,10506.3241,W,000.0,000.0,040510,010.5,
E*65\r\n
2010 05 04 19:37:42.5430 0.1614 72 $GPGGA,193743,3906.0352,N,10506.3241,W,1,06,4.2,2391.6,M,-21.3,M,,
*47\r\n
```

The absolute time in the NMEA messages is the HHMMSS field between the commas after \$GPRMC or \$GPGGA. The \$GPRMC NMEA message for 183334 was received and timetagged with a system clock value of 18:33:34.7163, which is a typical lag of .7163 seconds. After the gap, the first NMEA message with a value 193743 was assigned a timetag of 19:37:42.3816, indicating that the system clock was 1 second early.

On Jun 11 the value of the "time2" parameter was changed to 0.8 seconds and ntp restarted on the data system. By looking at the data_dump it appears that NTP corrected the system clock around 20:53:43 UTC.

```
2010 06 11 20:53:42.1074 0.9465 73 $GPRMC,205343,A,3906.0359,N,10506.3337,W,000.0,206.3,110610,010.5,
E*66\r\n
2010 06 11 20:53:42.2698 0.1624 72 $GPGGA,205343,3906.0359,N,10506.3337,W,1,06,1.6,2398.5,M,-21.3,M,,
*4F\r\n
2010 06 11 20:53:44.7440 2.474 73 $GPRMC,205344,A,3906.0358,N,10506.3338,W,000.0,206.3,110610,010.5,
E*6F\r\n
2010 06 11 20:53:44.9072 0.1632 72 $GPGGA,205344,3906.0358,N,10506.3338,W,1,06,1.6,2398.7,M,-21.3,M,,
*44\r\n
```

NTP was adjusting the Linux system clock for a minute or two prior to 20:53:43 and so the accuracy of those timetags is unknown. For example, the 20 Hz sonic data shows a jump forward of 1.598 seconds at this time. It looks like NTP and the Linux kernel first slowed the the clock down for a period of time and then made a ~1.55 second jump forward.

```
data_dump -i 1,100 -H ../raw_data/manitou_20100611_120000.dat | more
...
2010 06 11 20:53:42.7157 0.05111      12 48 00 26 02 fc 01 d7 09 d0 0f 55 aa
2010 06 11 20:53:42.7647 0.04894      12 55 ff 9a 01 64 02 e8 09 d1 0f 55 aa
2010 06 11 20:53:44.3625 1.598        12 8a fe f0 01 45 02 53 0a d2 0f 55 aa
2010 06 11 20:53:44.4117 0.04916      12 d9 ff 35 02 0d 02 8e 0a d3 0f 55 aa
2010 06 11 20:53:44.4631 0.0514       12 37 01 42 02 d9 01 b9 0a d4 0f 55 aa
```

After the correction on Jun 11 the absolute accuracy of the data system clock should be generally better than 300 microseconds.

Much ado about nothing...

- [turbtower](#)
- [data-system](#)



[7m TRH sick](#)

[Gordon Maclean](#) posted on Jul 12, 2010

The 7m TRH has been sick since about Jun 23. It looks like a bad RS232 connection. The data is good for periods of time, then garbage.

Here's a bit of data where it was in a and out:

```
data_dump -A -i 1,220 manitou_20100627_120000.dat | more

2010 06 27 13:44:10.4165 22.59      20 \xfc\xfe1\xfe~3f\x04984\xe02929\r\n
2010 06 27 13:44:12.0258 1.609      26 \xfc\xfe10.\xf08\xe088\xee33 4985 2929\r\n
2010 06 27 13:44:13.6407 1.615      29 T\xde\x8f?\xfe10.08 88.30 4985 2928\r\n
2010 06 27 13:44:15.2587 1.618      31 TRH009 10.06 88.30 4984 0928\r\n
2010 06 27 13:44:16.8703 1.612      31 TR\x8f\x00\xff\xe010.06 88.33 4984 \x00929\r\n
2010 06 27 13:44:18.4900 1.62       30 TR\x80\x06\xff10.06 88.35 4984 0830\r\n
2010 06 27 13:44:20.1026 1.613      62 TRH009\xe010.04 88.37 4982 09\xc0\x8b\xd6\x98\xf8TR\xf800\xf9\xe010.05
88.48 4
983 093\x05\r\n
```

- [trh](#)
- [turbtower](#)



[Sapflow sensors installed near turbulence tower \(May 13, 2010\)](#)

[harley](#) posted on Jun 17, 2010

On May 13, two sapflow sensors were installed on each of 12 trees approx. 50 m SE of the turbulence tower. Heat flux data will be downloaded at approx. 2-week intervals, and anyone interested in the data should contact Jia Hu (jiahu@ucar.edu). At some point, heat fluxes will be converted to sapflow data and available to help constrain water flux measurements made at the turbulence tower. Sometime in the next couple of weeks, soil moisture sensors (3 depths) will also be installed at two locations within the sapflow array.

- [turbtower](#)



[Site visit May 28, 2010 - 16m TRH](#)

[Edward \(Ned\) Patton](#) posted on May 28, 2010

16m TRH has been missing since May 21, 2010 and acting up since as early as May 11.

Upon arrival, there was no fan operating on the 16m TRH. Determined that the coupling between the 5 and 15m cables going to the 16m TRH had taken on water and/or was corroded. Replaced 15m cable (upper section) of the cabling to the 16m TRH due to the corrosion. Bottom 5m cable should be replaced too. Kurt taped the current coupling and inserted a drip loop. Should be ok for a while. Verified that the TRH was now operational and that data was now being collected.

Also replaced TRH external housing (shield, fan, firmware, etc), but used the original SHT sensor in this new housing.

Work today finalized by about 1pm LT.

On site: Kurt Knudson and Ned Patton

- [turbtower](#)
- [trh](#)



[looking into butanol issue in seatainer 4](#)

[jimsmith](#) posted on May 07, 2010

Just wanted to mention that we're looking into the butanol issue with seatainer 4. Butanol is used for the particle counters, and we are attempting to get rid of as much of the vapors as possible.

ACD had a catastrophic failure of the laptop controlling the particle size instrument. Last good data from that is May 3rd at 9:10pm. That system is down until we can replace the computer.



[Site visit May 4 \(network outage, TRHs, tower\)](#)

[Gordon Maclean](#) posted on May 05, 2010

Karl Schwenz, Chris Golubieski, Gordon Maclean

Objectives:

- Diagnose and fix reason that system has been offline for last few days (no data in Boulder after April 27).
- Replace data system box in order to take the old box back to Boulder for a tuneup.
- Replace top TRHs which have not been working well. Add new radiation shields.
- Replace barometer with external unit.
- Make anti-climb door easier to latch.

Arrived at site, May 4 10:30.

Chris climbed tower and replaced the TRH transducer/PIC units, and replaced the radiation shields with picnic plates 😊.

| height | previous | new |
|--------|----------|-----------|
| 2m | TRH012 | no change |
| 7m | TRH011 | TRH009 |
| 16m | TRH015 | TRH004 |
| 30m | TRH013 | TRH001 |
| 43m | TRH016 | TRH006 |

Replaced the barometer. New unit is B1 with chassis outside of the DSM. Old was B9, inside the DSM.

Karl fixed the anti-climb door. Works like a breeze now. If door is ever difficult to latch give a hand knock on the bottom right corner to shift it to the left. Hinge bolts should be replaced with correct size on a future visit.

System was up and taking data. (Reporting about 1000 spurious interrupts per second, then later 500 after Chris replaced some TRHs). The pocketec disk has data files for April 28 to the present, so no loss of data. Could not ping manitou server, 192.168.100.1, at other end of fiber link. Power cycling the fiber /copper media converter at the tower did not help. In retrospect I should have also cycled power on the 5 port switch. Cycling power on the media converter in the seatainer also did not bring it back. Only the power LED was lit on the converter at the tower, not SDF (signal detect fiber), SDC (signal detect copper), or RXC/F (receive copper/fiber). I am not sure whether the SDC LED was on in the seatainer.

Site note: There is a strong smell of what I believe is butanol in the seatainer where the turbulence tower fibers are terminated. This is the first seatainer as one drives into the site. There are several butanol bottles in that seatainer.

The manual for the fiber/copper network converters (Transition Networks, model E-100BTX-FX-05) describes the dip switch options. I've cut and pasted some of the manual to the end of this entry. It seems that we should disable the link pass-through and far-end fault options on both converters. Link pass-through and far-end fault options can cause a copper interface to be disabled if a fault is detected on the remote copper interface or on the fiber. These options appear to be for a building network with good network monitoring equipment. Perhaps a power outage, cable disconnect, or powering down a network switch could cause the converters to think there is a fault in the copper ethernet or the fiber, and then the copper interfaces would be disabled. The manual says nothing about whether the interfaces are automatically brought up if the fault disappears.

Dip switch 1 is auto-negotiation of speed and duplex and that was left enabled=UP. Set switches 2, 3 and 4 DOWN on both converters, to disable pause control, link pass-through and far-end fault.

Pause control should be enabled if ALL devices attached to the media converters have it. I didn't know if the ethernet switches have it, so I disabled it (dip switch 2 DOWN). I now think that was a mistake and that all modern ethernet switches have pause control. So I suggest that we set switch 2 UP on both units, and power cycle them on the next visit.

With 1=UP, and 2,3,4=DOWN and power cycling both units, the link came back and we could ping the seatainer. Swapped data boxes and then couldn't ping. Eventually power cycled the 5 port switch at the tower and things worked again.

New data box is swapped in and all sensors are reporting. Taking the original pocketec back to Boulder so the system at the tower now has a different pocketec unit.

From the manual for the converters:

Pause Control

The Pause feature can improve network performance by allowing one end of the link to signal the other to discontinue frame transmission for a set period of time to relieve buffer congestion.

NOTE: If the Pause feature is present on ALL network devices attached to the media converter(s), enable the Pause feature on the media converter(s). Otherwise, disable the Pause feature

Link Pass-Through

The Link Pass-Through feature allows the media converter to monitor both the fiber and copper RX (receive) ports for loss of signal. In the event of a loss of an RX signal (1), the media converter will automatically disable the TX (transmit) signal (2), thus, "passing through" the link loss (3). The far-end device is automatically notified of the link loss (4), which prevents the loss of valuable data unknowingly transmitted over an invalid link.

| near-end device | <-1-> local media converter | -2-> remote media converter | <-3-> far end device |
|-----------------|-----------------------------|-----------------------------|----------------------|
|-----------------|-----------------------------|-----------------------------|----------------------|

| | | | |
|-----------------------------------|---|-------------------------------------|--|
| original fault on copper link (1) | local media cvtr sends loss signal over fiber (2) | remote disables ethernet device (3) | |
|-----------------------------------|---|-------------------------------------|--|

Far-End Fault

When a fault occurs on an incoming fiber link (1), the media converter transmits a Far-End Fault signal on the outgoing fiber link (2). In addition the Far-End Fault signal also activates the Link Pass-Through, which, in turn, disables the link on the copper portion of the network (3) and (4).

| near-end device | <-4-> media converter A | original fault on fiber (1) -1-> media converter B | <-3-> far end device |
|-----------------|-------------------------|--|----------------------|
|-----------------|-------------------------|--|----------------------|

media converter A disables copper link (4)

media converter B detects fault on (1), disables the copper (3) sends far-end fault signal to A over fiber (2)

- [turbtower](#)
- [network](#)
- [trh](#)



16m TRH acting up

Gordon Maclean posted on Apr 13, 2010

TRH at 16 meters has had sporadic problems since Apr 8 07:00 MDT.


Over Apr 10,11 and 12 it seems to come alive in the warmest part of the day, (at temps over 10C) and then fails as the temp falls in the evening. See plot below.

Here is a dump of some recent data (times in GMT).

Looks like the processor is getting reset, printing out its calibration information when it boots. Perhaps the power is dropping out?

Corroded connection?

[illegible]

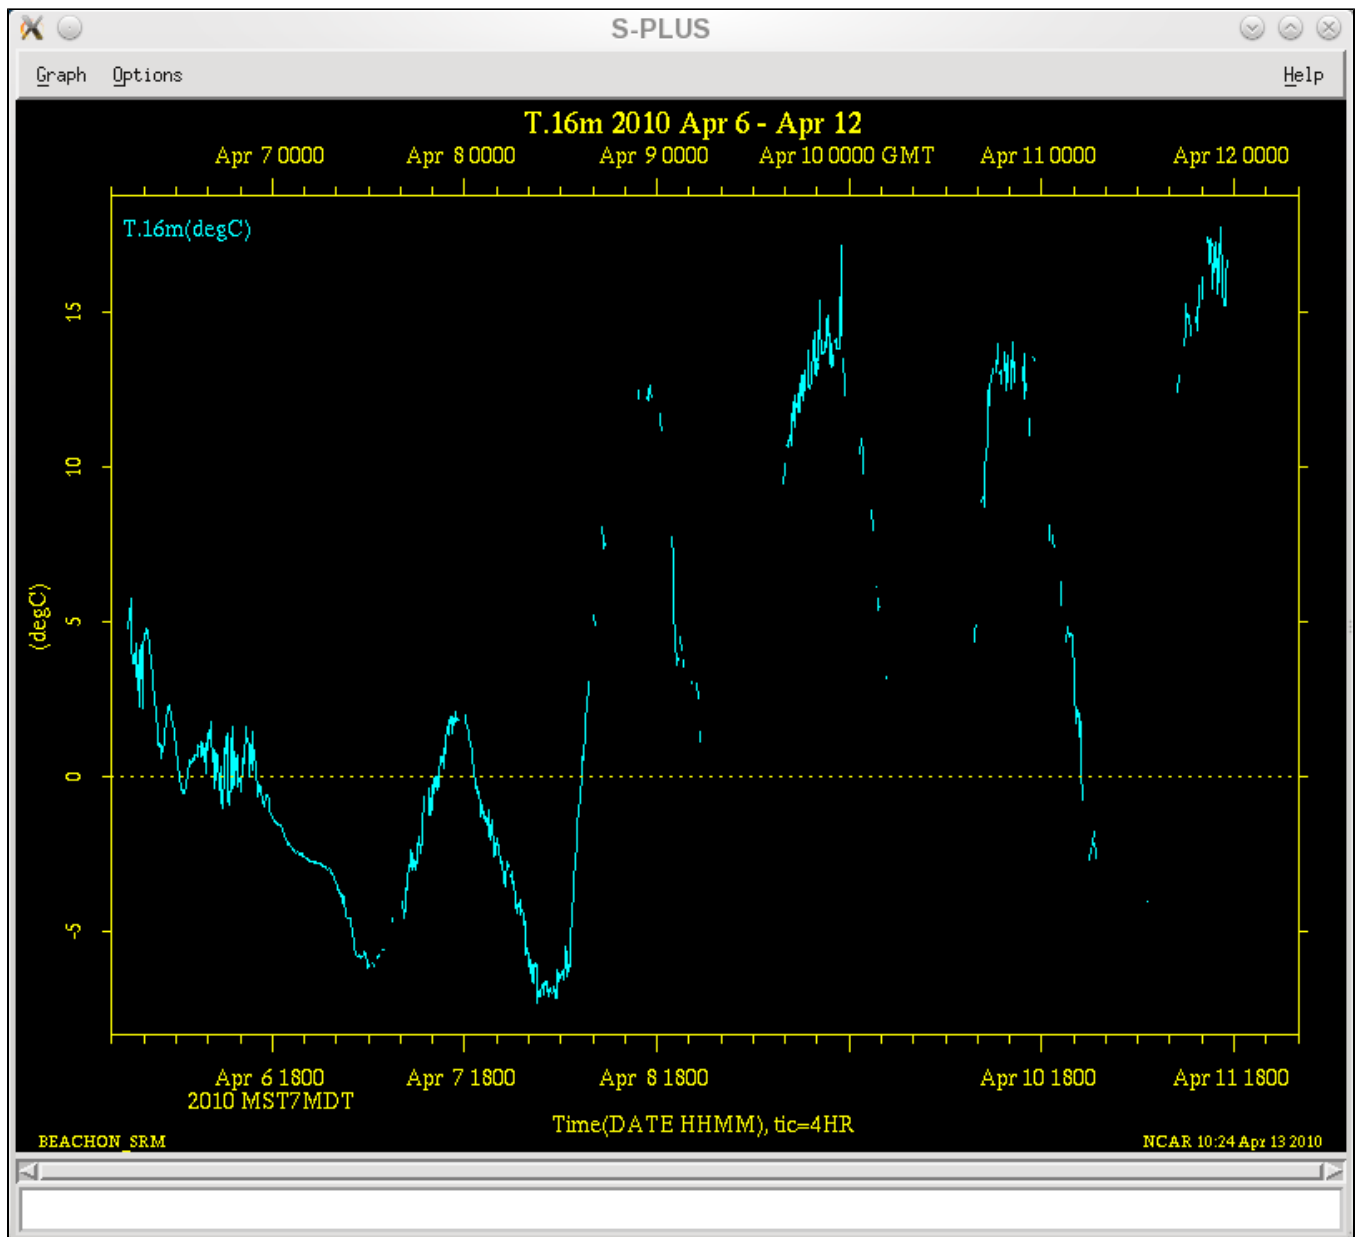

- [turbtower](#)
- [trh](#)



TRH at 30m bad data

Gordon Maclean posted on Mar 16, 2010

The TRH at 30m is acting up. Here is the data when it goes bad:

```
data_dump -i 1,420 -A manitou_20100314_120000.dat | more
```

```
2010 03 14 13:17:07.8073 0.82 31 TRH013 -4.18 88.21 3565 2887\r\n
2010 03 14 13:17:08.6281 0.8208 31 TRH013 -4.17 88.21 3566 2887\r\n
2010 03 14 13:17:09.4474 0.8194 31 TRH013 -4.19 88.21 3564 2887\r\n
2010 03 14 13:17:10.2680 0.8206 31 TRH013 -4.17 88.21 3566 2887\r\n
2010 03 14 13:17:11.0874 0.8194 31 TRH013 -4.17 88.19 3566 2886\r\n
2010 03 14 13:17:11.6405 0.5531 32 TRH013 560.79 -10099.38 -1 -1\r\n
2010 03 14 13:17:12.1912 0.5508 33 TRH013 560.79 -860.91 -1 29695\r\n
2010 03 14 13:17:12.7506 0.5594 33 TRH013 560.79 -728.27 -1 28671\r\n
2010 03 14 13:17:13.3080 0.5573 33 TRH013 560.79 -602.91 -1 27647\r\n
2010 03 14 13:17:13.8614 0.5534 33 TRH013 560.79 -602.91 -1 27647\r\n
2010 03 14 13:17:14.4180 0.5565 33 TRH013 560.79 -484.86 -1 26623\r\n
```

And when it comes back:

```
2010 03 14 13:25:23.2688 0.5591 33 TRH013 560.79 -374.10 -1 25599\r\n
2010 03 14 13:25:23.8211 0.5522 33 TRH013 560.79 -484.86 -1 26623\r\n
2010 03 14 13:25:24.3795 0.5584 33 TRH013 560.79 -602.91 -1 27647\r\n
2010 03 14 13:25:24.9310 0.5516 33 TRH013 560.79 -602.91 -1 27647\r\n
2010 03 14 13:25:25.6989 0.7679 35 TRH013 -4.18 -1418.74 3565 27647\r\n
2010 03 14 13:25:26.5223 0.8234 31 TRH013 -4.17 88.04 3566 2880\r\n
2010 03 14 13:25:27.3417 0.8193 31 TRH013 -4.17 88.06 3566 2881\r\n
2010 03 14 13:25:28.1604 0.8188 31 TRH013 -4.17 88.04 3566 2880\r\n
```

Note that the delta-Ts when it is working correctly are around 0.82 secs and when it goes nuts are around 0.55 sec. Steve thinks it may be a PIC processor issue.

- [turbtower](#)
- [trh](#)



[Site visit for CNR1, TRH](#)

[Gordon Maclean](#) posted on Mar 12, 2010

Ned Patton, Sylvain Dupont, Gordon Maclean

March 12, 2010, 9:15 MST arrived at tower

Plan: correct problem of spotty CNR1 data, replace TRH fan at 2 meters

rserial on port 19 showed no CNR1 data. Power cycled CNR1 by unplugging/replugging. No data.

Switched CNR1 cable to port 5 (2 meter TRH's port). CNR1 works on that port.

Changed config to use unused port 14 as the CNR1 port. CNR1 also works on that port.

Power on port 19 looked OK, and TRH worked on that port.

9:27 MST: new fan in 2 meter TRH.

Ned determined that the 7 meter TRH fan was noisy, so we replaced that too.

System voltage, as measured by the DVM in the serial test box, fluctuates from 11.8 to 13.2 volts, with a period of something like 10 seconds. I assume that is due to the trickle charger.

At one point I saw the CNR1 data pause for about 20 seconds, and then several records came out at once. That was after it had been running for a while - not at startup.

Off tower at 10:30. Left site after a tour up the walkup tower and chem seatainer.

- [turbtower](#)
- [trh](#)
- [radiation](#)



[Verify licor connections](#)

[Gordon Maclean](#) posted on Feb 04, 2010

On Feb 4, logged into system from Boulder to verify the serial numbers of the licors:

| port | SN | assumed height |
|-------------|------------------|--------------------------------------|
| 2 | 1163 | 2m. Moved from port 14, 30m on Feb 2 |
| 7 | 1166 | 7m |
| 20 (was 17) | 1167 | 16m |
| 14 | now disconnected | |
| 11 | 1164 | 43m |

This agrees with the configuration previous to Feb 2, and the changes of Feb 2: move of the 30m unit (SN1163) to 2m, and the move of the cable from the 16m unit (SN1167) from port 17 to port 20 on the new data system box.

To check the licor serial numbers do:

```
adn                # shut down data process
minicom ttySN      # N is port number
ctrl-a f          # sends break
(Outputs (RS232 (EOL "0A0D")))) # enable carriage return in output
(Coef ?)           # display serial number
(Outputs (RS232 (EOL "0A")))) # new-line termination, resume output
ctrl-a q          # quit minicom
aup               # restart data process
ds                # wait 10-15 seconds
ctrl-c            # verify sampling rates
```

- [turbtower](#)
- [licor7500](#)



[Site visit, move licor, diagnose sampling issue, dead TRH fan](#)

Gordon Maclean posted on Feb 04, 2010

Feb 2, 2010: Patton, Golubieski, Maclean on site at 10:30 MST

Planned tasks:

- Move Licor 7500 from 30 meters to 2 meters
- Investigate why data system can't sample 4 7500's at 20 Hz
- Measure guy tensions

Noticed a high-pitch sound from a TRH fan. Chris determined it was the 16m TRH. The propeller had come off the shaft, and was not repairable. Swapped the 16m and 2m TRHs, so that it will be easy for someone to replace the low unit.

Therefore the TRH at 16m has not had fan ventilation for an unknown period of time up to Feb 2, and likewise for the 2m TRH after Feb 2, until it is replaced.

Initial licor 7500 serial port configuration:

| port | height | status |
|------|--------|---------------------|
| 2 | 2m | not connected |
| 7 | 7m | OK, 9600 baud, 10Hz |
| 17 | 16m | OK, 9600 baud, 10Hz |
| 14 | 30m | OK, 9600 baud, 10Hz |
| 11 | 43m | OK, 9600 baud, 10Hz |

Looked at RS232 transmit signal from Licors with oscilloscope and a serial breakout box. Ports 17,11 and 7 all showed clean, square signals, ranging from -7V to +7V.

Moved 30m licor to 2m.

Looked at the signal ground of the 2m licor inside the Licor box, with the oscilloscope probe ground connected to power ground. Saw hair-like spikes with a range of +- 1V at the bit frequency of the signal. By shorting signal ground to power ground we could get rid of these spikes.

Temporarily switched the cables on the 7m and 2m Licors, so that the 2m was plugged into port 7. Port 7 is on a Diamond Emerald serial card, which are the ports (5-20) that have not been working at 20Hz.

Up'd the sampling frequency of the 2m licor in port 7 to 20Hz, 19200 baud. Saw an increase in "spurious interrupts" which did not diminish when we shorted the signal and power grounds together, so those spikes do not seem to be the issue.

Swapped dsm chassis boxes, replacing box #1 with box #8. Also swapped PC104 stacks. This configuration did not work well at all, with data_stats showing bad data rates. Swapped original PC104 stack back, and still saw problem. Eventually noticed that the input from the licor on port 17 had lots of jibberish. Moved this to port 20 and it cleaned up and the data_stats looked OK. So now believe this sampling issue was due to a bad port 17 on the new box and not an issue with the pc104 stack.

The PC104 stack (which is what has been at the site all along):

| card | SN |
|----------------------------|----------|
| viper | #7, 3284 |
| serial ports 5-12, EMM-8M | W250017 |
| serial ports 13-20, EMM-8M | W237191 |
| power | W248060 |

This stack is now in box #8, which means it has a new Viasala barometer. rserial shows this is unit 9: B9 752.08 5.2\ r\n. The barometer in box#1 was unit B7.

Tried increasing the sampling rates of the licors to 20 Hz, 19200 baud. The number of spurious interrupts increased to somewhere around 600+. The system was generally keeping up, as shown by data_stats, but sometimes things looked bad. So reduced the rates back to 10Hz, 9600 baud. The system runs well, with a background level of around 170 spurious interrupts/sec, as it was before this visit.

The licor message length is between 44 and 49 characters. So at 20Hz this is roughly 10bits * 49 * 20/sec = 9800 bits/sec, so we must use 19200 baud instead of 9600 when sampling at 20 Hz.

Around mid-day Ned and Chris measured the guy tensions and those values have been added to the matrix in the blog entry.

Conclusions

The problem with sampling Licors at 20Hz seems to be a data system issue, in that it cannot keep up with the total serial interrupt load from the sensors on the tower. Based on what we saw on the scope, it is not an issue with the quality of RS232 signals. Since it didn't change when we swapped system enclosures and the PC104 stacks, it is not related to interface panels, the CPU or the serial cards. The power to the Licors looks good.

Our simulation of this configuration in the lab did not include 5 TRHs (1 sample/sec), the barometer (1/sec) or the GPS (2 samples/sec). The addition of these inputs seems to break the camel's back.

- [licor7500](#)
- [trh](#)
- [turbtower](#)
- [pressure](#)



Adjusting Licor 7500 sampling and baud rates

Gordon Maclean posted on Dec 02, 2009

The 2m licor connected to /dev/ttyS2 was removed today, and the licors at 16 and 43 meters were reconnected to ports /dev/ttyS17 and /dev/ttyS11 by a BEACHON helper.

By checking the serial numbers, with the (Coef ?) command, and comparing against the earlier LICOR log entry, we could determine remotely what unit is connected to what port. Note that the licors at 16 and 43 meters are switched from the previous configuration.

| port | height | SN |
|--------|---------|------|
| ttyS2 | removed | |
| ttyS7 | 7m | 1166 |
| ttyS11 | 43m | 1164 |
| ttyS14 | 30m | 1163 |
| ttyS17 | 16m | 1167 |

The data system from the time the licors on port 11 and 17 were enabled on Dec 2, until the next morning, Dec 3 at 10:26 AM MST was configured in the old way, so the data from the licor on port 17, SN 1167 was given an id of 1,310, and the data from the licor on port 11, SN 1164 was given an id of 1,510. So the licor data at 43 meters and 16 meters is cross-identified during that time period.

Basic 7500 configuration:

```
(Outputs (RS232 (EOL "0A") (Labels FALSE) (DiagRec FALSE) (Ndx FALSE) (Aux FALSE) (Cooler FALSE) (CO2Raw TRUE)
(CO2D TRUE) (H2ORaw TRUE) (H2OD TRUE) (Temp TRUE) (Pres TRUE) (DiagVal TRUE)))
```

First test: 4 licors running at 10Hz, 19200 baud

```
(Outputs (BW 10) (RS232 (Freq 10.0) (Baud 19200)))
```

This resulted in around 1200 spurious interrupts being reported in /var/log/isfs/kernel

Second test: 4 licors running at 5 Hz, 19200 baud

```
(Outputs (BW 5) (RS232 (Freq 5.0) (Baud 19200)))
```

This resulted in around 300 spurious interrupts/sec being reported in /var/log/isfs/kernel

Third test: 4 licors running at 5 Hz, 9600 baud

```
(Outputs (BW 5) (RS232 (Freq 5.0) (Baud 9600)))
```

This resulted in usually less than 50 spurious interrupts/sec being reported in /var/log/isfs/kernel. The kernel does not report more than 50/s, so there are very few reports of spurious interrupts showing up in /var/log/isfs/kernel.

Left it running at this setting.

Current values from /proc/tty/driver/serial:

```
2: uart:XScale mmio:0x40700000 irq:13 tx:543 rx:1136277465 fe:1947 RTS|DTR
7: uart:ST16654 port:F1000110 irq:104 tx:1111 rx:1153977325 fe:41917 RTS|DTR
11: uart:ST16654 port:F1000130 irq:104 tx:1585 rx:3762900 fe:21542 RTS|DTR
14: uart:ST16654 port:F1000148 irq:104 tx:1549 rx:575482383 fe:3996 RTS|DTR
17: uart:ST16654 port:F1000160 irq:104 tx:1079 rx:2059346 fe:2312 RTS|DTR
```

Next morning, tried fourth test:

Fourth test: 4 licors running at 10 Hz, 9600 baud

```
(Outputs (BW 10) (RS232 (Freq 10.0) (Baud 9600)))
```

This resulted in around 400-500 spurious interrupts/sec being reported in /var/log/isfs/kernel. The system is keeping up, top shows an idle value of ~ 70%. Here are the current values from /proc/tty/driver/serial. The number of framing errors is staying steady at this baud rate:

```
7: uart:ST16654 port:F1000110 irq:104 tx:1371 rx:1169013368 fe:41917 RTS|DTR
11: uart:ST16654 port:F1000130 irq:104 tx:2133 rx:18900757 fe:21542 RTS|DTR
14: uart:ST16654 port:F1000148 irq:104 tx:1809 rx:590564461 fe:3997 RTS|DTR
17: uart:ST16654 port:F1000160 irq:104 tx:1339 rx:17587617 fe:2321 RTS|DTR
```

Testing at FLAB

We've attempted to simulate the turbulence tower data acquisition configuration at FLAB, with an adam sampling 5 CSAT3 sonics at 20Hz and 1 Licor 7500 whose transmit and signal ground lines are forked to 5 separate serial ports. There is no GPS, CNR1, barometer or 5 TRHs on the test adam. We see no spurious interrupts, and the data system is keeping up with the 1x5 Licor set to 20Hz, 19200 baud. **top** shows a system idle value between 97 and 80%.

top on the adam at the turbulence tower shows 65-79 % idle. Other than the additional low rate serial sensors there is no difference between the 2 systems. They are both writing the full archive to a usbdisk.

- [turbtower](#)
- [co2](#)
- [licor7500](#)



Licors Installed on Turb.Tower, problems continue

John Miltzer posted on Nov 19, 2009

18Nov09 Site Visit: CG, KK, JM

- Purpose: Install 5 Licor 7500's

- Power: We rearranged the power / batteries to accomodate the licors. A high current/trickle/equalize battery charger was connected directly to the battery chain and not through the solar/battery charge by using the last 'external battery' amp connector. This was because an excessive feedback impedance from the Morningstar charge controller was causing the commercial battery charger to not see the proper battery voltage preventing it from starting up to supply the loads (ie battery charger was 'too smart'). A regulated, current limiting supply wouldn't care and could be cranked up to a voltage more closely approximating solar panels (ie 14-15vdc). There are now 3 batteries in the string. A power distribution Tee was connected to the 'fused load' of the primary battery box with one secondary going to the Adam and the other going to the 5 Licor chain. The licors are being powered directly because earlier tests showed that the voltage drop in our smaller gauge isfs serial cables was excessive and causing the higher-level licors to not have adequate supply voltage. The internal solar-battery-charger is being used only as a 'low-voltage-disconnect' switch for these 2 loads.

- Licors Installed. The 43m,30m serial cables had been added before, so we only installed those for 2.5,7.5,15m

| Level | Licor S /N | Adam ttySx | Freq, BPS | Comments |
|-------|------------|------------|-----------|---|
| 43m | 1164 | 17 | 10,9600 | Disconnected from panel, diamond board #2 |
| 30m | 1163 | 14 | 10,9600 | Refurbished recently |
| 15m | 1167 | 11 | 10,9600 | Disconnected from panel, diamond board #1 |
| 7.5m | 1166 | 7 | 20,19.2k | |
| 2.5m | 0813 | 2 | 20,19.2k | Refurbished recently, On Viper board |

- Licor Ingest Problems: **After installing the licors we observed many 'spurious interrupts' on the adam console.** These were caused by the licors, especially at 43, and 15m, but those were not the only ones. At first we thought the cables may have been 'funky' and tried removing some cable ties to no avail. When we disconnected the worst offenders, the adam was able to do a data_stats and the statistics for the licors looked ok, as did the console rserial printouts. However the diamonds/adam was having clear difficulty. Gordon was able to login to the system and reprogram a few of the sensors to try to slow them down to overcome these interrupts, and although at first it appeared that worked, it did not. Pow-wow time. I'm suspecting a power /serial ground issue combined with the serial driver circuit on the licors, although the diamond boards may be culpable. It is noteworthy that there are 2 different diamond boards involved in these. **We left the system running but with the 15 and 43m licors disconnected.**

[1 Comment](#)

- [turbtower](#)
- [licor7500](#)



Li7500 calibrations

Steve Oncley posted on Nov 13, 2009

Here are my notes from this week on the first servicing we've ever done on our Li7500s.

Note that S/N 0813 and 1166 came back from LiCor this summer after being repaired (from lightning damage), so no service was performed on them.

The following all was done using LiCor's software (installed on the Aspire). Before service:

| S/N | Last Cal | CO2 zero | CO2 span | H2O zero | H2O span | AGC |
|------|-------------|----------|----------|----------|----------|-----|
| 0813 | Didn't read | | | | | |
| 1163 | 24 Oct 06 | 0.8697 | 0.9968 | 0.8468 | 0.9946 | 49% |
| 1164 | 24 Oct 06 | 0.8883 | 1.017 | 0.8601 | 0.9980 | 50% |
| 1166 | 10 Jul 09 | 0.8896 | 1.0051 | 0.8583 | 0.9969 | 53% |
| 1167 | 24 Oct 06 | 0.8768 | 0.9978 | 0.8678 | 0.9961 | 48% |

On the afternoon of 10 Nov 09 (after Chris&Jen recovered them from MFO), I dumped the dessicant/scrubber (Magnesium Perchlorate; Ascarite2) from the bottles of 1163, 1164, 1167 and replaced with new Drierite and Ascarite2, following the manual instructions. I put a sticky label on one bottle in each sensor with this replacement date. Instructions say to have the sensors run for at least 4 hours before proceeding with calibrations, so they were all left overnight powered on.

On the afternoon of 11 Nov (~23 hours after changing chemicals), we went through the calibration procedure using a cal lab nitrogen tank for zero CO₂ and H₂O and a tank I borrowed from Teresa Campos/Cliff Heizer at 404.316ppmV for span CO₂. Both of these were supplied to the 7500 using the LiCor calibration tube at a flow rate of about 1.3 lpm. Span H₂O was achieved by placing the entire 7500 head in the Thunder chamber at T=25C, RH=80%, which should be a dewpoint of 21.31C. Since the electronics box was outside the chamber, the calibration tube was also placed in the chamber (though not in the optical path) to measure pressure. Since it seemed to take a long time (25 & 50 min, respectively to calibrate 1167 and 1163), we used the calibration tube's temperature reading when we calibrated 1164 the next day. This sped things up a bit. The calibration in the Thunder took long enough that 1164 was done the next morning. The new readings were:

| SN | Cal Date | CO2 zero | CO2 span | H2O zero | H2O span |
|------|-----------|----------|----------|----------|----------|
| 1163 | 11 Nov 09 | 0.8709 | 1.0082 | 0.8510 | 1.0229 |
| 1164 | 12 Nov 09 | 0.8902 | 1.0233 | 0.8635 | 1.0008 |
| 1167 | 11 Nov 09 | 0.8770 | 1.0207 | 0.8732 | 0.9986 |

AGC values were not logged, but noted to be within 1% of the earlier readings (even with the tube on).

With one exception, these values are higher than before service, indicating more absorption now. I note that I didn't clean the optics prior to this calibration, which probably should have been done, but spot checks of a few of the sensors looked pretty good.

Chris also ran 0813 and 1166 into the chamber (with a dewpoint still at 21.31C) and found that these sensors showed dewpoints of 22.07C and 21.45C, respectively. I'm a tiny bit concerned about this value from 0813.

Note that the LiCor software changed the instrument settings. They will be reset before (re)deployment at MFO.

- [co2](#)
- [licor7500](#)
- [turbtower](#)



[Increased sampling rate of 43m Licor 7500 from 10 to 20Hz](#)

[Gordon Maclean](#) posted on Nov 09, 2009
Nov 9, 12:30 MST.

Per Steve Oncley, increased the sampling rate of the Licor 7500 at 43 meters.
It is the only unit connected right now.

Commands to change the sampling rate:


```

# shut down data process
adn

# adn powers off port 17, power it back on.
eio 17 1

# start minicom
# The default baud rate of minicom on that port is 9600, which is what the 7500
# uses after it is sent a break. To set it to 9600 explicitly, use ctrl-A pe.
# Use ctrl-A minicom commands to turn on local echo (e), line wrap (w) and send a break(f).
# Set bandwidth to 20 and RS232 output frequency to 20.
# Set terminator to 0A (newline):

minicom ttyS17
ctrl-A pe
ctrl-A e
ctrl-A w
ctrl-A f
(Outputs (BW 20) (RS232 (Freq 20.0)))
ctrl-A f
(Outputs (RS232 (EOL "0A")))
ctrl-A f
(Outputs ?)
ctrl-A q

# minicom should now be finished

# power off port 17
eio 17 0

# start data process. This will power up port 17
aup

# wait a bit, then
ds
ctrl-C

# If the 7500 doesn't respond, try power cycling it:
eio 17 0
eio 17 1

```

- [turbtower](#)
- [licor7500](#)



[Tower splint, reinstall TRHs, install CNR1, Licors](#)

[Gordon Maclean](#) posted on Nov 06, 2009

On site: Golubieski, Semmer, Militzer, Maclean. Dave Gochis was also at the tower site, installing soil sensors.

Installed splint at ding in tower upright.

Reinstalled TRH transducers in ventilation units at all levels.

Started installing Licor 7500's. At 43 meters, S/N 1167, port ttyS17.

Measured total power draw at data system, prior to and after unit 1167 was installed:

| | | | Power | Add'l Power |
|------------------|--------|-------|--------|-------------|
| without 43m 7500 | 13.0 V | 1.4 A | 18.2 W | |

| | | | | |
|---------------|-----------|----------|-----------|--------|
| with 43m 7500 | 12.6 V | 3.0 A | 37.8 W | 19.6 W |
| settled to | 12.8 V | 2.3 A | 29.4 W | 11.2 W |

Measured power draw of the 43 meter 7500 only, with serial line power meter at the adam:

| | | | |
|------------------|-----------|----------|---------------|
| 43 meter 7500 | 12.4 V | .87 A | 10.8 Watts |
|------------------|-----------|----------|---------------|

Tried to prepare units 813 and 1163 for installation at 30 meters, but could not get them to boot and run with required length of cable. Red LED at circuit board would stay on, or blink on and off. It is supposed to go off once the unit is running. Measured 8 V at the end of 30 meter cable with unit attached.

Installed S/N 1163, and 1164 at 30 and 16 meters, but without data/power cables.

| level | Licor 7500 S /N | status |
|-------|--------------------|---------------------|
| 43m | 1167 | port 17, working |
| 30m | 1163 | not cabled |
| 16m | 1164 | not cabled |
| 7m | | |
| 2m | | |

DC power supply in the enclosure that is charging the batteries is rated at 3 A, which will not be large enough to drive system with 5 Licor 7500s, since each Licor needs about 0.9 A.

The beacon was running off a separately charged battery with an inverter. Connected the beacon directly to AC power and added the battery to the bank of 2 that power the data system and tower sensors. So the beacon is not a load on the DC supply anymore, and there are 3 batteries providing power to the tower, that are charged by the DC supply via a charge controller.

Installed Kipp and Zonen CNR1 net radiometer. Data is being received. Distance from top of CNR1 boom to top of tower base plate is 22.38 meters. Chris said that per the bubble level indicator the unit is quite level.

Distance from top of CNR1 boom to top of 16 meter sonic is 6.31 meters. So the top of this sonic boom is at $22.38 - 6.31 = 16.03$ meters.

Moved network switch from adam to power enclosure. Dave Gochis will probably use one of the ethernet ports for his Tsoil CR1000. After this switch, the fiber/copper media converter would not connect - even after several power cycles of converter and switch. Had to power cycle the media converter in the seatainer. This may mean that the fiber network will not always come up after a power outage without intervention.

Untaped pressure inlet (13:33 MST).

Updated NIDAS software on adam to version 5051M.

Installed anti-climb cage on tower.

- [turbtower](#)
- [trh](#)
- [pressure](#)
- [network](#)
- [power](#)
- [licor7500](#)
- [datasystem](#)
- [radiation](#)



[Pressure port covered](#)

[Gordon Maclean](#) posted on Oct 19, 2009

On the Oct 15 visit, Kurt noticed that the inlet of the barometer pressure port had been taped over, though the tape had peeled back and was no longer covering the inlet hole. Pressed the tape back down, but it probably won't stay.

It was probably taped on Oct 1 when the TRHs were removed in anticipation of a controlled burn.

So since Oct 1, the pressure data should not be trusted.

- [turbtower](#)
- [pressure](#)



[Connected AC power and fiber network](#)

[Gordon Maclean](#) posted on Oct 15, 2009

Oct 14. Arrived on site 10:55 MDT.

Kurt Knudson and Gordon Maclean (EOL) and Fabian Guerrero and Armando Cisneros from CISL/NETS.

Installed DC power supply in the power/network enclosure at turbulence tower. It is charging one battery for the beacon and two batteries for the data system and sensors.

Removed solar panels and other batteries from the site.

Fabian and Armando terminated and tested the fibers, installed fiber patch panels at the tower enclosure and in the seatainer, and connected the fiber/copper media converters. The media converters are from Transition Networks, model E-100BTX-FX-05. I believe that they are the standard temperature models (not the "HT", versions), and so their temperature range is 0 to 50 degC. At the tower the converter is in the metal enclosure. Hopefully the converter's own heat and heat from the DC supply will keep it warm enough.

The 30 foot run of ethernet cable from the enclosure to the data system at the tower is currently an indoor-rated cat 5 cable, with RJ45 connectors on each end. It is routed through a 1/2 inch hole in the side of the adam and through a knock-out in the bottom of the enclosure. It should be replaced with an outdoor rated cable through conduit to prevent critter chewing.

We removed the WIFI equipment and cables at the turbulence tower and the walkup tower.

Configured the data system with IP address 192.168.100.202. With the fiber link it is now directly on the 192.168.100 subnet.

The etherant (unit C) at the turbulence tower was not working. Saw no light on the power LED, but the DC-DC converter was delivering 15 V to the interface panel inside the adam.

The adam had been working, though it wasn't reachable over the wifi because of the problem with etherant C. The pocketec (#5) contained 12 days of data. Swapped in pocketec #3 and brought back #5 to Boulder.

Updated the NIDAS software on the system, revision 4985.

Measured the power draw of the data system with 5 sonics, GPS, barometer, PC104 stack and pocketec disk (no etherant): 12.8 Volts, current: 1.4 to 1.61 A.

The fiber link was operational at 2:20 MDT. Left site shortly after. Late lunch at the BuckSnort in Sphinx Park.

- [turbtower](#)
- [network](#)
- [power](#)



[power installation completed](#)

[Edward \(Ned\) Patton](#) posted on Oct 15, 2009

Paul Painter from Green Mountain Falls Electric completed the installation of the electrical enclosure at the turbulence tower, and the connecting of the power cables at either end on October 7. So, line power should now be available at the turbulence tower.

The service should be 5 kVa, there should be two circuits each with outlets inside the enclosure and water proof outlets outside the enclosure.

- [turbtower](#)
- [power](#)



[power and data cables installed](#)

[Edward \(Ned\) Patton](#) posted on Oct 06, 2009

Power cable and data cables between the walk-up and turbulence towers were trenched into position on Monday, October 5 2009. Connections at either end of the cables will be completed shortly.

- [turbtower](#)
- [power](#)
- [data](#)



[October 1, 2009](#)

[Chris Golubieski](#) posted on Oct 02, 2009

Mostly Sunny. Cold and breezy.

Karl and I inspected "ding" in tower. Nothing was resolved of what could've done this dent. There's not paint/led/copper transfer for a bullet/arrow. It almost looks like someone tried to hang something over wrenched it. ??

TRH's sensors were removed and taken back to NCAR. Some of them were VERY dusty. I kept shields and cables all plugged in and at their heights. However, I did remove all TRH port fuses. So be careful when opening the ADAM box since the fuses are just loose inside.

Taped pressure port.

Removed one battery from the beacon battery bank and added it to the ADAM battery bank. So four batteries on ADAM and two on beacon. Also took a rack of panels(good ones) from the beacon and moved it to the two banks for the ADAM. So hopefully where they are positioned we will have more charging throughout the day. Beacon's one rack is getting morning and some afternoon sun. All batteries seem to be around 12.5V. ADAM was down when we arrived (~10:30).

Took guy-wire tensions. Will add readings to the guy-wire sheet. They look good!

Boom angles (rough shots). Starting from 2m to 45m (in degrees). 40.9, 46.3, 41.9, 72.9, 109.3. I don't feel very comfortable with the data scope. We may want to shoot with theodolite. Add 180 degrees to these angles.

Removed Oncley's trailer from ACD site.

Fire line is covered again with pine needles. FYI.

- [turbtower](#)
- [trh](#)
- [power](#)
- [sonics](#)



[16m TRH out](#)

[Gordon Maclean](#) posted on Sep 21, 2009

The 16 meter TRH did not survive the power outages on Sep 16.

It was running fine up to the 03:20 am dropout but has just given a few sporadic points since.

I logged into the manitou system and tried rserial to port 11 (rs 11), but got nothing back.

- [trh](#)
- [turbtower](#)



[Power outages](#)

[Gordon Maclean](#) posted on Sep 21, 2009

The data system at manitou died at around 03:20 am MDT on Sep 16, and came back at 8:30 am. It died again at 10:34 pm Sep 16 and came up at 8:30 the next morning. Looks like we're not getting enough solar charging.

It has stayed up since Chris G swapped batteries on Sep 18.

- [power](#)
- [turbtower](#)




[Sept 17, 2009](#)

[Chris Golubieski](#) posted on Sep 18, 2009

Stopped by the 45m tower and noticed a fire line that has been scratched around the tower and anchors. The line comes about five feet from anchors and approx. seven feet from solar panels. Looked a little close if the burn gets out-of-hand. Also swapped NDAQ and beacon batteries. The batteries on beacon were around 13V while the NDAQ were at 11V. The solar panels for the NDAQ were really never in the sun while I was there (~9 - 10am) with the beacon panels were in full sunlight the whole visit time.

Firelines

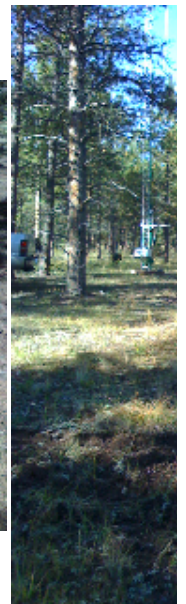



- [turbtower](#)



[Turbulence Tower GPS Coordinates](#)

[Edward \(Ned\) Patton](#) posted on Sep 02, 2009

N 39°06.045'

W 105°06.319'

2385m elevation

- [turbtower](#)



[2m sonic boom azimuth](#)

[Edward \(Ned\) Patton](#) posted on Aug 29, 2009

246°

GPS unit was set to true north.

Used the ACD/BEACHON Magellan GPS from the Chemistry trailer.

Should be confirmed due to potential operator error.

- [turbtower](#)
- [sonics](#)



[T.2m replaced](#)

[Steven Semmer](#) posted on Aug 21, 2009

Andy Turnipseed replaced the 2m TRH on Wednesday. So far so good.

- [turbtower](#)
- [trh](#)



[RH.2m still bad](#)

[Gordon Maclean](#) posted on Aug 14, 2009

TRH015, installed at 2m on Aug 12 18:51 UTC also reports incorrect humidities. Its cutoff is around 45%. Above 45% the reported humidity is anti-correlated with the 4 other sensors - looking more like a temperature.

In this plot, the night of Aug 11-12 shows the problem with unit 013, and the next night shows the problem with 015:

- [turbtower](#)
- [trh](#)



replaced 2m TRH sensor

Alex Guenther posted on Aug 13, 2009

replaced 2m TRH sensor at 11:50 MST on August 12

Added by maclean:

Old unit was TRH013, new is TRH015. Here's a data_dump:

```

2009 08 12 18:51:00.1002 0.839 30 TRH013 28.47 13.81 6804 506\r\n
2009 08 12 18:51:00.9311 0.8308 30 TRH013 28.43 13.73 6800 504\r\n
2009 08 12 18:51:01.7703 0.8392 30 TRH013 28.34 13.59 6791 501\r\n
2009 08 12 18:51:09.4970 7.727 3 \x00\r\n
2009 08 12 18:51:10.7516 1.255 17 \r Sensor TRH015\r\n
2009 08 12 18:51:10.7625 0.01084 29 \rcalibration coefficients:\r\n
2009 08 12 18:51:10.8164 0.05398 21 Ta0 = -4.036598E+1\r\n
2009 08 12 18:51:10.8577 0.04124 21 Ta1 = 1.024538E-2\r\n
2009 08 12 18:51:10.9015 0.04383 21 Ta2 = -2.186790E-8\r\n
2009 08 12 18:51:10.9406 0.0391 21 Ha0 = -1.041986E+1\r\n
2009 08 12 18:51:10.9814 0.04083 21 Ha1 = 4.165513E-2\r\n
2009 08 12 18:51:11.0218 0.04031 21 Ha2 = -3.136109E-6\r\n
2009 08 12 18:51:11.0664 0.04469 21 Ha3 = 6.878648E-2\r\n
2009 08 12 18:51:11.1117 0.04531 21 Ha4 = 7.258961E-5\r\n
2009 08 12 18:51:11.4406 0.3289 30 TRH015 29.78 14.38 6950 540\r\n
2009 08 12 18:51:12.2807 0.84 30 TRH015 29.82 14.42 6954 541\r\n
2009 08 12 18:51:13.1207 0.84 30 TRH015 29.88 14.39 6960 540\r\n
2009 08 12 18:51:13.9616 0.841 30 TRH015 29.93 14.39 6965 540\r\n

```

- [turbtower](#)
- [trh](#)



RH.2m bad after Jul 30

Gordon Maclean posted on Aug 07, 2009

RH at 2m went walkabout on about Jul 30 02:30 MDT.

After that time it disagrees with the other RH's above ~60%. This looks like what we saw in ASP09.

This may have happened during a rain event - the sonic diagnostic flags were high during that time.

- [turbtower](#)
- [trh](#)



CSAT parameters

Gordon Maclean posted on Aug 04, 2009

The following dump of CSAT sonic parameters is from /var/log/isfs/manitou_BEACHON_SRM_csar3.log on the data system. It was generated on Jul 17 when the data acquisition process was last started.

These serial numbers agree with Chris' sensor height blog entry.

```

{{
#####
csat3: manitou:/dev/ttyS1 SN1124 3.0f
time: 2009 07 17 19:42:24
ET= 20 ts=i XD=d GN=212a TK=1 UP=5 FK=0 RN=1 IT=1 DR=102 rx=2 fx=038 BX=0 AH=1 AT=0 RS=1 BR=0 RI=1 GO=00000 HA=0 6X=3 3X=2 PD=2
SD=0 ?d tf=02600 02600 02600
WM=o ar=0 ZZ=0 DC=4 ELo=016 016 016 ELb=016 016 016 TNo=bea d TNb=ad9 JD= 007
C0o=-2-2-2 C0b=-2-2-2 RC=0 tlo=8 8 8 tlb=8 8 8 CA=1 TD= duty=050 AQ= 20 AC=1 CD=0 SR=1 UX=0 MX=0 DTU=02320 ss=1 XP=2 RF=018 DS=007
SN1124 31jul08 JC=3 CB=3 MD=5 DF=05000 RNA=1 sa=1 rev 3.0f cs=17145 &=0 os=
#####
csat3: manitou:/dev/ttyS6 SN1120 3.0f
time: 2009 07 17 19:42:27
ET= 20 ts=i XD=d GN=312a TK=1 UP=5 FK=0 RN=1 IT=1 DR=102 rx=2 fx=038 BX=0 AH=1 AT=0 RS=1 BR=0 RI=1 GO=00000 HA=0 6X=3 3X=2 PD=2
SD=0 ?d tf=02600 02600 02600
WM=o ar=1 ZZ=0 DC=4 ELo=016 016 016 ELb=016 016 016 TNo=bdc d TNb=bcc JD= 007
C0o=-2-2-2 C0b=-2-2-2 RC=0 tlo=8 8 8 tlb=8 8 8 CA=1 TD= duty=046 AQ= 20 AC=1 CD=0 SR=1 UX=0 MX=0 DTU=02320 ss=1 XP=2 RF=018 DS=007
SN1120 05jun08 JC=3 CB=3 MD=5 DF=05000 RNA=1 sa=1 rev 3.0f cs=38395 &=0 os=
#####
csat3: manitou:/dev/ttyS10 SN0673 3.0f
time: 2009 07 17 19:42:31
ET= 20 ts=i XD=d GN=445a TK=1 UP=5 FK=0 RN=1 IT=1 DR=102 rx=2 fx=038 BX=0 AH=1 AT=0 RS=1 BR=0 RI=1 GO=00000 HA=0 6X=3 3X=2 PD=2
SD=0 ?d tf=02600 02600 02600
WM=o ar=0 ZZ=0 DC=4 ELo=015 016 016 ELb=015 016 015 TNo=cda d TNb=ecc JD= 007
C0o=-2-2-2 C0b=-2-2-2 RC=0 tlo=7 8 8 tlb=7 8 7 CA=1 TD= duty=050 AQ= 20 AC=1 CD=0 SR=1 UX=0 MX=0 DTU=02320 ss=1 XP=2 RF=018 DS=007
SN0673 13nov07 JC=3 CB=3 MD=5 DF=05000 RNA=1 sa=1 rev 3.0f cs=59504 &=0 os=
#####
csat3: manitou:/dev/ttyS15 SN0672 3.0f
time: 2009 07 17 19:42:35
ET= 20 ts=i XD=d GN=535a TK=1 UP=5 FK=0 RN=1 IT=1 DR=102 rx=2 fx=038 BX=0 AH=1 AT=0 RS=1 BR=0 RI=1 GO=00000 HA=0 6X=3 3X=2 PD=2
SD=0 ?d tf=02600 02600 02600
WM=o ar=0 ZZ=0 DC=4 ELo=015 016 015 ELb=015 016 015 TNo=8bb d TNb=abb JD= 007
C0o=-2-2-2 C0b=-2-2-2 RC=0 tlo=7 8 7 tlb=7 8 7 CA=1 TD= duty=049 AQ= 20 AC=1 CD=0 SR=1 UX=0 MX=0 DTU=02320 ss=1 XP=2 RF=018 DS=007
SN0672 14nov07 JC=3 CB=3 MD=5 DF=05000 RNA=1 sa=1 rev 3.0f cs=62873 &=0 os=
#####
csat3: manitou:/dev/ttyS16 SN0677 3.0f
time: 2009 07 17 19:42:39
ET= 20 ts=i XD=d GN=443a TK=1 UP=5 FK=0 RN=1 IT=1 DR=102 rx=2 fx=038 BX=0 AH=1 AT=0 RS=1 BR=0 RI=1 GO=00000 HA=0 6X=3 3X=2 PD=2
SD=0 ?d tf=02600 02600 02600
WM=o ar=0 ZZ=0 DC=4 ELo=016 016 016 ELb=016 016 016 TNo=99b d TNb=a9a JD= 007
C0o=-2-2-2 C0b=-2-2-2 RC=0 tlo=8 8 8 tlb=8 8 8 CA=1 TD= duty=050 AQ= 20 AC=1 CD=0 SR=1 UX=0 MX=0 DTU=02320 ss=1 XP=2 RF=018 DS=007
SN0677 30oct07 JC=3 CB=3 MD=5 DF=05000 RNA=1 sa=1 rev 3.0f cs=06092 &=0 os=
#####
}}

```

- [turbtower](#)
- [sonics](#)



Sensor Heights

Chris Golubieski posted on Jul 28, 2009

BEACHON Heights and Sensors

*Note: The heights were from top of boom to top of plate.

```

42.86m CSAT 0677
TRH
29.90m CSAT 0672
TRH
16.06m CSAT 0673
TRH
7.42m CSAT 1120
TRH
2.04m CSAT 1124
TRH

```

- [turbtower](#)
- [sonics](#)
- [trh](#)



Turbulence Tower Guy-Wire Tensions

John Militzer posted on Jul 28, 2009

BEACHON Tower Guy-Wire Tensions (lbs).....THIS SHOULD BE AN ON-GOING LOG

Inner to Outer...

South Guy-Wire:

| Guy-Wire | 7/7/09 Sharon (7/8/09 Ned) | 7/17/09 Ned | 8/28/09 Ned | 10/01 /09 Chris | 02/02 /10 Chris /Ned | 05/28 /10 Kurt /Ned | 7/22/10 Kurt & company (re- tensioned all guy wires) | 3/29 /11 Kurt /Ned | 7/31/11 Chris /Ned | 10/14/11 Chris /Semmer | 8/15/2012 Chris /Jesse |
|------------------------|-------------------------------------|----------------|----------------|-----------------------|-------------------------------|------------------------------|---|-----------------------------|--------------------------|------------------------------|------------------------------|
| Inner (Close to tower) | 500 (425) | 425 | 350 | 375 | 350 | 250 | 385 | 380 | 300 | 320 | 275 |
| | 550 (510) | 460 | 405 | 450 | 415 | 340 | 385 | 375 | 340 | 340 | 310 |
| | 500 (420) | 380 | 355 | 350 | 350 | 300 | 395 | 365 | 325 | 330 | 320 |
| | 500 (500) | 460 | 415 | 450 | 430 | 350 | 375 | 390 | 325 | 350 | 300 |
| | 500 (400) | 370 | 330 | 325 | 320 | 275 | 440 | 400 | 350 | 380 | 345 |
| Outer (Farthest) | 450 (400) | 350 | 330 | 350 | 340 | 290 | 390 | 350 | 335 | 340 | 300 |

Northwest Guy-Wire:

| Guy-Wire | 7/7/09 Sharon (7/8/09 Ned) | 7/17/09 Ned | 8/28/09 Ned | 10/01 /09 Chris | 02/02/10 Chris /Ned | 05/28 /10 Kurt /Ned | 7/22/10 Kurt & company (re-tensioned all guy wires) | 3/29/11 Kurt /Ned | 7/31 /2011 Chris /Ned | 10/14/11 Chris /Semmer | 8/15/2012 Chris /Jesse |
|------------------------|----------------------------------|----------------|----------------|-----------------------|---------------------------|------------------------------|--|-------------------------|--------------------------------|------------------------------|------------------------------|
| Inner (Close to tower) | 600 (490) | 450 | 375 | 380 | 360 | 300 | 450 | 440 | 350 | 390 | 330 |
| | 550 (500) | 450 | 405 | 440 | 400 | 325 | 395 | 390 | 325 | 350 | 300 |
| | 450 (500) | 470 | 445 | 450 | 450 | 390 | 475 | 440 | 425 | 430 | 400 |
| | 600 (500) | 450 | 400 | 425 | 400 | 340 | 380 | 390 | 325 | 350 | 300 |
| | 440 (415) | 410 | 355 | 375 | 355 | 300 | 425 | 390 | 350 | 370 | 320 |
| Outer (Farthest) | 430 (400) | 360 | 345 | 350 | 340 | 300 | 400 | 390 | 350 | 360 | 330 |

Northeast Guy-Wire (nearest to the road)

| Guy-Wire | 7/7/09 Sharon (7/8/09 Ned) | 7/17/09 Ned | 8/28/09 Ned | 10/01 /09 Chris | 02/02/10 Chris /Ned | 05/28 /10 Kurt /Ned | 7/22/10 Kurt & company (re-tensioned all guy wires) | 3/29/11 Kurt /Ned | 7/29/11 Chris /Ned | 10/14/11 Chris /Semmer | 8/15/2012 Chris /Jesse |
|------------------------|----------------------------------|----------------|----------------|-----------------------|---------------------------|------------------------------|--|-------------------------|--------------------------|------------------------------|------------------------------|
| Inner (Close to tower) | 580 (470) | 440 | 360 | 400 | 395 | 300 | 420 | 410 | 340 | 355.5 | 340 |
| | 600 (550) | 500 | 425 | 450 | 440 | 350 | 450 | 450 | 370 | 400 | 360 |
| | 680 (670) | 590 | 575 | 625 | 610 | 525 | 500 | 550 | 500 | 550 | 520 |
| | 500 (460) | 450 | 375 | 375 | 380 | 300 | 425 | 400 | 340 | 360 | 340 |
| | 600 (525) | 500 | 425 | 440 | 405 | 325 | 475 | 425 | 400 | 410 | 400 |
| Outer (Farthest) | 480 (405) | 410 | 360 | 400 | 370 | 330 | 450 | 400 | 400 | 400 | 400 |

Modifications:

090717, jwm Added readings by Ned Patton on 7/17/09. **Note roughly 100-lb drop on each**, but there was no shift on the anchors/base per-paint applied; ie stretching.

090828, egp Anchors did not exhibit any shifting, added new readings to the tables above.

091001, csg Anchors looked good. Tensions were fine. May need some tensioning on South guy-wires soon.

100528, egp Anchors looked good, not shifting. Kurt recommends re-tensioning guy wires complete with transits to re-plumb tower. July 2010?

7/22/10 re-tensioned all guy wires using transits to plumb tower, also replaced 7m & 15m trh cables as well as 7m trh sensor.

111014, csg Check tensions. All looked great!

8/15/2012: csg Tower looking a little odd up top. Ned did notice the tower was a little wobbly towards the top. Tower should be re-tensioned this year.

- [turbtower](#)
- [tensions](#)
- [beachon](#)



[Wifi network to Turbulence Tower](#)

[Gordon Maclean](#) posted on Jul 24, 2009

Jul 17, 2009

Installed AP24, 802.11 access point on walkup tower, just above the 11th section. Ethernet IP: 192.168.100.202, Wireless IP: 192.168.12.251.

Borrowed 100 ft white cat 5 cable in server seatainer for the run from the network switch in the seatainer up the tower.

Installed a Patton Model 570 ethernet surge protector in the seatainer. I believe it was installed between the white cable coming from the tower and the AP24 power injector. The other possibility is that it was installed between the AP24 power injector and the network switch. It was grounded to a cover plate screw on a power outlet.

Installed etherant on turbulence tower, 192.168.12.35. It is connected to the eth1 port on the front of the adam. Installed a 4 port linksys switch in the adam.

Viper CPU in ADAM has address 192.168.12.167.

Set up ssh port forwarding so that Viper is addressable from 192.168.100 net without a routing table entry.

Installed a Patton 570 surge protector inside the adam at the flux tower, grounded to the chassis, between the inside RJ45 connector of the ethernet port on the interface panel and the 4 port switch in the box.

- [turbtower](#)
- [network](#)
- [walkuptower](#)
- [beachon](#)